

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

94 JAN 21 PM 3 28

For corners in

<u>NEWAYGO</u> (County)	Located In:	Corner Code ##
1. Public Land Survey	T <u>16N</u> R <u>13W</u>	<u>K-8</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Marlene Toogood

VOL 001 PAGE 62

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Norman L. Ochs, in a field survey on December 1, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

W-1/4 Corner, Section 24, Lilley Twp.

A. Description of original monument and accessories and/or subsequent restoration:

- | | |
|-----------------------------|----------------------------------|
| G.L.O. John Hodgson 1837 | 1977 R. A. Griffin #13584 |
| 10" Hemlock S22°W 14 lks #1 | 5" x 36" conc. mon. w/brass cap |
| 8" Maple N55°E 11 lks #2 | 13" W. Oak S48°W 70.27' #4 |
| | 7" W. Oak N85°W 33.85' #5 |
| Lyle S. Shepherd's Book | 4" Maple N38°W 62.18' #6 |
| 20" Pine Stp. S37°W 46' #3 | 4" x 7' Pine Post West 33.04' #7 |
| | LCRC #460 |

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Oct. 7, 1977 Robert A. Griffin found nothing. He established corner by equal distance and on a straight line between controlling Section corners. Set 5" sq. x 36" conc. mon. with brass cap.


Found R. A. Griffin's conc. mon. with brass cap in good condition.

Condition of recorded witnesses: #1 thru #3 gone, #4 and #5 good condition, #6 gone, #7 good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted R. A. Griffin's conc. mon. with brass cap as a substantial marker for the 1/4 corner and is accepted as a careful and faithful re-establishment of the position of the original corner.

- 8" Maple N30°W 52.17' Spike in Easterly side of tree.
- 13" W. Oak S48°W 70.29' Spike in North side of tree #4.
- 7" W. Oak N85°W 33.97' Spike in North side of tree #5.
- 4" x 7' Pine Post West 33.05' Nail in South side of Post #7.

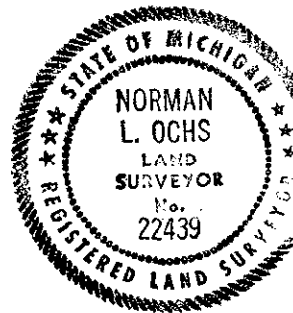

Signed by Norman L. Ochs Date December 20, 1993

Surveyor's Michigan License No. 22439

Approved by Peer Review Group Dec. 21, 1993
Norman L. Ochs, County Representative