

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ontonagon
 (County)

Located In: Corner Code #

- | | | |
|------------------------------------|-----------------------------|-------|
| 1. Public Land Survey | T <u>52</u> N R <u>37</u> W | L9 |
| | T ___ R ___ | _____ |
| | T ___ R ___ | _____ |
| | T ___ R ___ | _____ |
| 2. Property Controlling in Section | S ___ T ___ R ___ | _____ |
| | S ___ T ___ R ___ | _____ |
| 3. Miscellaneous Property in Sec. | S ___ T ___ R ___ | _____ |
| | S ___ T ___ R ___ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Jan 29 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												


A. Description of original monument and accessories and/or subsequent restoration:
 Remonumented in 1964 by Billy D. Buckler at the position of a wooden post found at record bearing and distance from an original bearing tree stump W.Pine 48° N35E 47 links. 1" iron pipe with 4" aluminum cap. 14" W.Spruce N09W 115 links, 6" Cedar N47E 76 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Recovered the 1964 monument, a 1" ID iron pipe with 4" aluminum MI Dept. of Conservation tablet, appropriately stamped, in good condition, at record bearing and distance from the original W.Pine 8T noted above, now a 3' tall stump with face rotted and fallen, with scribe marks visible, and at record bearing and distance from the 1964 NBTs W.Spruce, now dead and down, with scribing visible, and the Cedar, in good condition with scribing visible. Left the monument in place and made new witnesses as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found 1" ID iron pipe with 4" alum. MDGC cap. Blazed and scribed:
 7" W.Spruce S32E 18.0' "1/4S NBT"
 7" Cedar N60W 34.8' do
 7" Y.Birch N25E 26.9' do
 9" Cedar N49E 49.7' (1964 NBT)
 Squared cedar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.

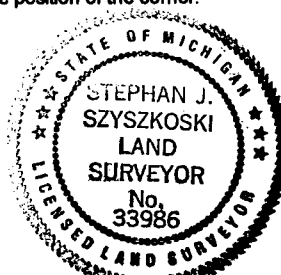

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 10/23/01

For the Michigan Department of Natural Resources - Office of Property Management