

**SURVEY &
REMONUMENTATION**

DEC 13 2000

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in Osceola	Located in:	Corner Code#
1. Public Land Survey	T 17 N	R 7 W D-9
	T	R
	T	R
	T	R
2. Property Controlling in Section	S T	R
	S T	R
3. Miscellaneous Property in Sec.	S T	R
	S T	R
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		

OSCEOLA COUNTY
 REGISTER OF DEEDS
 00 OCT 11 AM 9:48
 Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on **May 31, 2000**, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

D-9 - 1/4 Corner common to Sections 20 & 29, T17N, R7W

A. Description of original monument and accessories and/or subsequent restoration:

1848 - O. Lyon, G.L.O.
 #1 - 14" Hemlock N38°E 18 Links
 #2 - 14" Beech N82°W 11 Links

1891-1904 - F. Trumbull, Co. Sur.
 "Identified by Stake & OBT Stump".
 #3 - 3" Maple S49 1/4°W 24 1/4 Links
 #4 - 3" Willow N10 1/2°W 50 Links

1998 - R.L. Wetherell, LS 24624
 L.C.R.C. - Liber 03, Pg. 171
 Set by single proportionate method.
 #5 - P. Pole N12°W 255.98'
 #6 - Center of East End of 18"
 C.M.P. N20°E 123.19'
 #7 - 6" Tri. Maple S75°E 109.47'
 #8 - 10" Maple S14°E 103.37'

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:

I found the 1/2" Capped Iron I sent in 1998. Corner is 8 feet West of the center of two-track road over earthen dam. In 1998 I talked to longtime resident Donald Marsh, who constructed the dam, and he said the corner was there when he built the dam. There is approximately 15 feet of fill over the corner location. The measurements East and West to the respective Section corners is 2608.51 feet. Corner is in line with an old tree line to the North.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Found in good condition, #6 Found in good condition, #7 Found in good condition, #8 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1/2" Capped Iron with a 1" x 30" Pipe with Osceola County Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

P. Pole N12°W 255.98' (P.K. Nail W. side) #5
 Center East End 18" C.M.P. N20°E 123.19' #6
 6" Triple Maple S75°E 109.47' (60d spike S. side) #7
 10" Maple S14°E 103.37' (60d spike E. side) #8

APPROVED LAND CORNER
 P.A. 345 OF 1990
 Osceola County
 8-17-2000
 R. L. W.

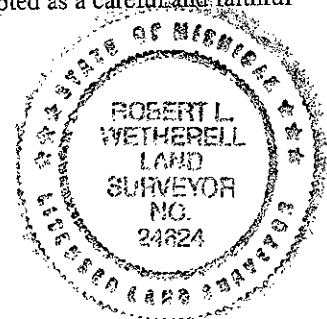

Signed by Robert L. Wetherell
 Surveyor's Michigan License No. 24624

Date August 22, 2000