


**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Osceola</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>17N</u> R <u>9W</u>	<u>K-2</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

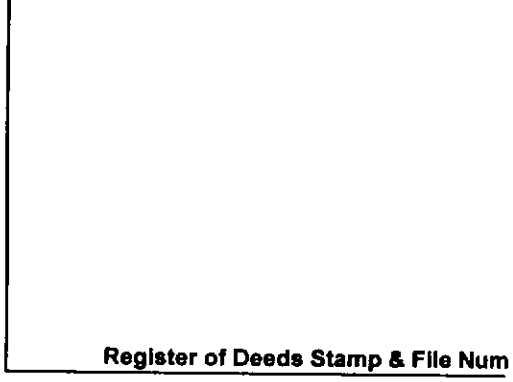

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, Craig W. McVean, in a field survey on March 30, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2	●	1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

**A. Description of original monument and accessories and/or subsequent restoration:**

- K-2 - GLO - Set post - J. Hodgson - 1838 - Beech 7" N45°E 17L.  
Maple 7" N88°W 7L.
- Osceola Co. Remon - 1900 + Temple and/or Trumbull set Iron & Tile Mon. at GLO corners.
- LCRC - L.1, P. 385 - Matt McClung - 1975 Triple Maple N30°E 46.8'  
12" Maple (spike west side 30.8')
- LCRC - L.1, P. 400 - Matt McClung - 1976 same witnesses as above.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

- K-2 - 1/4 corner common to Sec.1 & 2, T17N, R9W. FND. 3/4" Iron rod in 3" Dia. tile. Drove 4" DNR A.C. on 1" x 3' long iron pipe over iron rod in tile. Built ring of conc. stone. Monument accepted as the best available evidence of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- K-2 - DNR Mon. in Tile.  
S3°W 30.68' to N&T in W. Side 20" R. Oak (MM).  
\*S25°E 22.12' to set N&T in NE Side 10" W. Oak - Scribed 'XBT'.  
S72°W 20.27' to set N&T in S. Side 5" R. Maple - Scribed 'XBT'.  
N19°E 6.29' to set N&T in W. Side 4" R. Maple - Scribed 'XBT'.  
FND. Cedar post 0.3' NE to Face.  
Set Blue Carsonite post 1' N.

\* Along side old nail.



Signed by Craig W. McVean  
 Surveyor's Michigan License No. 39088

Date 4/20/1998