


DEC 13 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in <u>Osceola</u>	Located in:	Corner Code#
1. Public Land Survey	T 17 N R 10 W	L-13
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		


OSCEOLA COUNTY REGISTER OF DEEDS
00 NOV -2 PM 4: 10
 Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on September 18, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

L-13 - S. ¼ Corner 36, T17N, R10W.

A. Description of original monument and accessories and/or subsequent restoration:

1837 - J. Hodgson, G.L.O.
 #1 - 8" Beech N69°E 46 Links
 #2 - 12" Beech N19°W 9 Links

Undated from Co. Sur. Twp. Notes
 2" Pipe
 #3 - Fence Post S. 29.5'
 #4 - Fence Post N. 26.7'
 #5 - Ironwood S.E. 53.8'
 Called corner common to N. ¼ Sec. 1, T16N, R10W

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:

I found a ¾" pipe directly over an old 2" pipe in the center of an East and West road. Corner is in line with old fence berms to the North and South.

NOTE: This corner has been used and accepted as the ¼ corner common to Section 36, T17N, R10W and Section 1, T16N, R10W. Based on the absence of evidence to the contrary, I am accepting this corner as the S. ¼ corner of Sec. 36, T17N, R10W.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the ¾" pipe with a 1" x 18" Iron Pipe with an Osceola Co. Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

P. Pole N3°W 34.66' (spike in E. side)
 Ironwood S8°W 33.26' (60d spike E. side)
 10" R. Pine N33°E 442.38' (60d spike W. side)
 P.K. Nail in top of 7' diameter boulder N72°E 84.43'

APPROVED LAND CORNER
 P.A. 345 OF 1990
 Osceola County
R. L. W.
10-31-2000

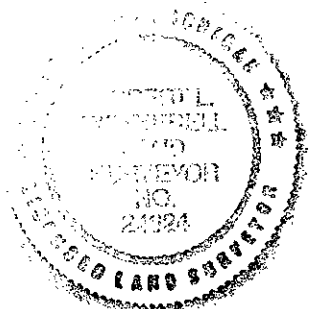

Signed by Robert L. Wetherell
 Surveyor's Michigan License No. 24624

Date November 1, 2000