

**SURVEY &
REMONUMENTATION**

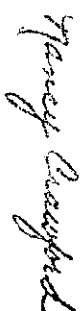
DEC 13 2000

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in Osceola	Located in:	Corner Code#
1. Public Land Survey	T 17 N R 10 W	M-13
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		


**OSCEOLA COUNTY
REGISTER OF DEEDS**
00 NOV - 2 PM 4: 11
 Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on September 18, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

M-13 - Sec. corner common to Sec. 36, T17N, R10W & A-13 - Sec. 31, T17N, R9W.

A. Description of original monument and accessories and/or subsequent restoration:

1837 - J. Hodgson, G.L.O.
 #1 - 10" Sugar S67°E 7 Links
 #2 - 12" Hemlock N67°W 6 Links

1906 - L. June, Co. Sur.
 Mecosta Co. Sur. Notes
 Pg. 142 - "Old Tile Corner".

1972 - W. Batzer, LS 13026
 L.C.R.C. - Liber 01, Pg. 58.
 3/4" Pipe over 3/4" Bar.
 #5 - Fence Post N37°W 39.25'
 #4 - Fence Post N47°E 44.84'
 #6 - P. Pole S14°E 98.87'

1894-1904 - Temple/Trumbull
 Remonumented T17N, R9W with
 3" Clay Tiles.

Undated Co. Sur. Twp. Book
 "Tile & Rod".
 #3 - Ironwood N.W. 153.3'
 #4 - Fence Post N.E. 42.6'
 #5 - Fence Post N.W. 38'

1988 - D. Wood, LS 24625.
 Survey recorded L. 495, Pg. 668.
 No accessories given.

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:

I found a 3/4" pipe over top a 3/4" rod in a 3" Clay Tile. Corner is in the intersection of roads North, South, East and West.

Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Did not measure, #4 Found down, #5 Found lying down, #6 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 3/4" pipe with a 1" x 18" Iron Pipe with an Osceola Co. Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- P. Pole S12°E 99.06' (60d spike E. side) #6
- 9" Maple N85°E 117.33' (60d spike N. side)
- 12" S. Pine N32°E 253.05' (60d spike W. side)
- 16" Pear N31°W 247.74' (center of tree)

APPROVED LAND CORNER
 P.A. 745 OF 1990
 Osceola County
R. L. W.
10-31-2000



Signed by Robert L. Wetherell
 Surveyor's Michigan License No. 24624

Date November 1, 2000

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN. 1983
 ADAPTED FOR WORD PROCESSING JANUARY, 1999