

# LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 18 N. R. 8 W.	B-7;B-11;C-7;C-9;C-11
2. PROPERTY CONTROLLING IN SECTION	T. N. S., R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. S., R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Kenneth J. Ostling, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 11, 1977, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

C. (continued)

C-9	C-11
Left 1/2" iron in tile mon. in place	Left 1/2"x3 1/2' iron rod in place
23" R. Pine N35°W 48.28	Clump of 4 3"-8" W. Birch S35°E 39.15
12" R. Pine S45°E 108.38	2" Maple S05°E 82.51
8" W. Pine S52°W 51.60	Set cedar post w/loc. tag
Set cedar post w/loc. tag	Due S 33
Due W 33'	


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- B-7 Found iron-tile mon. beneath 4' road fill, in line with fences north and south.
- B-11 Found 3/4" pipe as previously established in local survey; falls in line with fences north and south.
- C-7 Found iron at road intersection N-S-E-W, apparently used in subdivision of Sec. 19.
- C-9 Found iron-tile mon. at corner, about 5' west of road intersection.
- C-11 Found 1/2" iron bar in place about 3' NE of road intersection.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-7	B-11	C-7
Fd. iron in tile buried 4 1/2' raised up w/steel fn.post	Fd. 3/4" pipe added 5/8x40" rod w/RLS cap in ctr. E-W rd.	Left 3/8"x1 1/4"x25" iron with twist & 90° bend on top end
3" Oak N75°E 44.5	11" Maple in clump of 3 S30°E 63.0	in place
9" Cedar S10°W 22.5	20" R. Oak S37°W 35.5	5" S. Pine N45°E 86.08
Center 3' stream Due W 19	Set cedar post w/loc. tag	7" Maple in clmp. S85°W 137.46
Set cedar post w/loc. tag	Due N 33	6" Twn.W.Pine N53°W 100.80
Due N 33		

SIGNED BY *Kenneth J. Ostling* DATE 12-16-77  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 10068

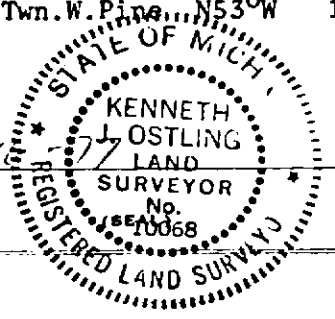

FOR STATE AND UNITED STATES AGENCIES:  
 SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY  
 APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ OSCEOLA TOWNSHIP  
 OSCEOLA COUNTY

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET