

**SURVEY &
REMONUMENTATION**

DEC 18 2000

LAND CORNER RECORDATION CERTIFICATE

SECTION

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in <u>Osceola</u>	Located in:	Corner Code#
1. Public Land Survey	T 18 N R 8 W	K-3
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. <u> </u> Recorded Plat <u> </u>		
5. Private Claims <u> </u>		

OSCEOLA COUNTY
REGISTER OF DEEDS

00 OCT 11 AM 9:45

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on May 22, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

K-3 - Section corner common to Sections 1, 2, 11 & 12, T18N, R8W

A. Description of original monument and accessories and/or subsequent restoration:

- | | | |
|---|--|---|
| <u>1848 - O. Lyon, G.L.O.</u>
#1 - 12" Sugar S65°W 19 Links
#2 - 13" Sugar N55¼°E 14 Links | <u>1891 - 1904 - Temple/Trumbull/June</u>
Remonumented T18N, R8W with
3" Clay Tiles with cinders. | <u>1895 - F. Trumbull, Co. Sur.</u>
Co. Sur. Twp. Book
Pages 62 and 63.
(Big Book)
"Recorded Tile"
#3 - distance South = 2605.68' |
|---|--|---|

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:

I found a ½" Pipe at surface of gravel road. Directly below pipe I found a ½" iron in a 3" Clay Tile. Corner is in centerline of East and West road and 6 feet West of centerline of North and South road.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Measured 2626'.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I placed a 1" x 18" pipe with Osceola County Remon Cap directly over the ½" rod in tile, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 13" Maple N75°E 81.24' (60d spike S.E. side)
- 7" Elm S16°E 75.25' (60d spike W. side)
- P. Pole S36°E 58.32' (P.K. Nail N.E. side)
- 9" Elm N15°W 113.67' (60d spike E. side)
- Top of pointed boulder N59°W 78.3'

APPROVED LAND CORNER
P.A. 345 OF 1990
Osceola County
R L W
8-17-2000

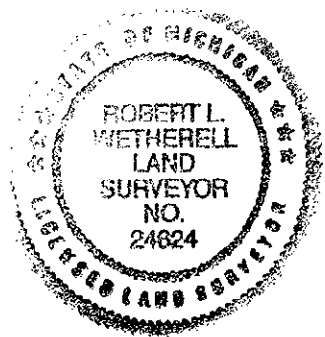

Signed by Robert L. Wetherell Date August 22, 2000
Surveyor's Michigan License No. 24624

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN.28, 1971
REVISED MAY 14, 1975
REVISED JAN. 1983
ADAPTED FOR WORD PROCESSING JANUARY, 1999