

**SURVEY &  
REMONUMENTATION**

DEC 13 2000

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in <u>Osceola</u>	Located in:	Corner Code#
1. Public Land Survey	T 18 N R 9 W	M-8
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		

OSCEOLA COUNTY  
REGISTER OF DEEDS  
00 OCT 11 AM 9:50  
*[Signature]*

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, a field survey on July 19, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

M-8 - E. 1/4 Cor. Section 24, T18N, R9W, - W. 1/4 Cor. Section 19, T18N, R8W

**A. Description of original monument and accessories and/or subsequent restoration:**

1838 - J. G. Hodgson, G.L.O.  
#1 - 10" Beech S75°W 30 Links  
#2 - 7" Beech N48°W 51 Links

1891-1904 - Temple/Trumbull  
Remonumented T18N, R8W  
With 3" Clay Tiles with Cinders.

1977 - K. Ostling, LS 1068  
L.C.R.C. - Liber 02, Pg. 4.  
"Found tile and iron and one Temple B.T. Stump".  
Set D.N.R. Monument.  
#3 - 3" Maple N10°W 9.8'  
#4 - 8" R. Oak S50°E 16.9'  
#5 - 10" R. Oak S72°W 15.5'  
#6 - Old 30" P. Stump N55°E 20.5'

**B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:**

I found Ostling's D.N.R. Monument along side a 3" clay tile filled with cinders. The corner is in an old fence line (down) running North and South.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in good condition, #4 Found in good condition, #5 Found in good condition, #6 Found in good condition.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I accepted the D.N.R. Monument (1" Pipe with D.N.R. Cap), as a substantial marker for the corner, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 11" Tw. R. Oak S77°W 16.55' (60d spike N. side) #5
- 10" R. Oak S48°E 16.82' (60d spike S.W. side) #4
- 8" R. Oak N56°E 23.48' (60d spike N.W. side)
- 5" Maple S11°E 4.41' (60d spike E. side)

APPROVED LAND CORNER  
P.A. 345 OF 1990  
Osceola County  
R.L.W.  
8-17-2000

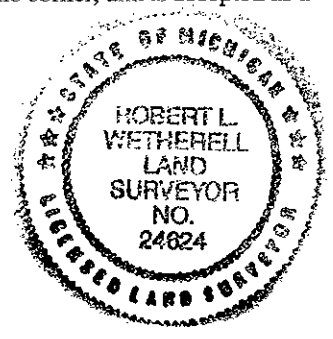

Signed by Robert L. Wetherell  
Surveyor's Michigan License No. 24624

Date August 22, 2000

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN. 1983  
ADAPTED FOR WORD PROCESSING JANUARY, 1999