

SURVEY & REMONUMENTATION

DEC 13 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in Osceola Located in: Corner Code#

1. Public Land Survey T 18 N R 10 W H-1
 T R
 T R
 T R

2. Property Controlling S T R
 in Section S T R

3. Miscellaneous S T R
 Property in Sec. S T R

4. Lot No. _____ Recorded Plat _____

5. Private Claims _____

George Bradford
 OSCEOLA COUNTY
 REGISTER OF DEEDS
 00 MAY -5 PM 2:50
 Register of Deeds Stamp & File Number

I, Robert L. Wetherell, in a field survey on April 22, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:


	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

H-1 - North 1/4 Corner Section 3, T18N, R10W

A. Description of original monument and accessories and/or subsequent restoration:

1998 - R.L. Wetherell, LS 24624

Set corner on Township line midway between the Northwest corner and Northeast corner of Section 3, (2623.99 feet each way)
 Corner falls 5.45 feet West of South 1/4 corner Section 34, T19N, R10W
 #1 - 13" Maple S55°E 16.40'
 #2 - 12" Maple N57°E 47.13'
 #3 - 13" Tw. Maple N33°W 32.54'
 #4 - 11" Maple S69°W 19.36'

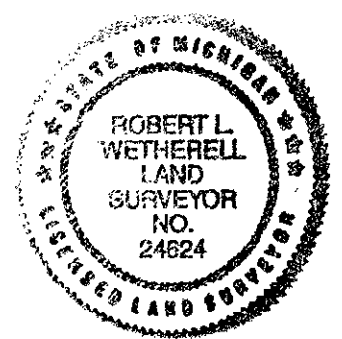

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:

I found the 1/2" Capped Iron I set in 1998. Corner is in old fence line running East and West.

Condition of the accessories are as follows: #1 Found in good condition, #2 Found in good condition, #3 Found in good condition, #4 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1/2" Capped Iron with a 1" x 18" Pipe with Osceola County Remon Cap. This position not established by original government surveyors. The monument is accepted as the best available evidence of the position of the corner.

- 13" Maple S55°E 16.40' (60d spike S.W. side) #1
- 12" Maple N57°E 47.13' (60d spike S.E. side) #2
- 13" Tw. Maple N33°W 32.54' (60d spike S.W. side) #3
- 11" Maple S69°W 19.36' (60d spike S. side) #4
- Osceola County Monument East 5.45' (S. 1/4 Cor. Sec. 34, T19N, R10W)

APPROVED LAND CORNER
 P.A. 345 OF 1990
 Osceola County
R. L. W.
 4-20-2000

Signed by Robert L. Wetherell
 Surveyor's Michigan License No. 24624

Date April 25, 2000