

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 19 ^{N.} <input checked="" type="radio"/> R. 10 ^{W.} <input checked="" type="radio"/>	E-1; C-2
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ ^{N.} <input type="radio"/> ^{S.} <input type="radio"/> R. _____ ^{E.} <input type="radio"/> ^{W.} <input type="radio"/>	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} <input type="radio"/> ^{S.} <input type="radio"/> R. _____ ^{E.} <input type="radio"/> ^{W.} <input type="radio"/>	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on September 6, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-1 Restored NE cor of Sec. 5 (19-10) on line between found SE & SW cor's of Sec. 33 (20-10) being 1/2" rods in tiles (probably Temples); & on line between fd. E 1/4 Sec. 5 (RLS J. Erickson fd. 1/2" rod, probably Temples) & fd. rod in tile remains (Erickson fd. tile & set rod to save position) for control (departure) for NE Sec. 5. The NE of Sec. 5 as restored falls 5.57' S (see wit.) of said 5/8" rod in tile remains. Geo. Johnson's 1917 survey of Sec. 5 (notes in Co. Sur. Rec. at Baldwin) indicate all sec. & 1/4 sec. cor's are 3" tile & iron rod (probably by Temple-Roser comment).
- C-2 Fd. 1/2"x48" rod in two 3" tiles. Fits 1917 Geo. Johnson survey of Sec. 5 whose notes indicate tile & rod (probably Temples - Roser comment).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-1	C-2
Set DNR Mon. & Cedar Post	Fd. 1/2"x48" rod; added DNR Mon. & Cedar Post
11" Sugar Maple S35°E 19.8	5" Cedar N15°E 16.8
26" Sugar Maple S35°W 23.8	14" Cedar S70°E 28.0
Fd. 5/8" rered (in tile remains)	9" Cedar S60°W 14.8
N00°21'W 5.57	SE'ly edge Pine River Due N 76'±
SE S-32 T20N-R10W N89°51'W 29.44	SE'ly edge Pine River Due W 63'±
Old E-W fence Due N 5	


SIGNED BY Carl F. Roser DATE 7-9-80

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

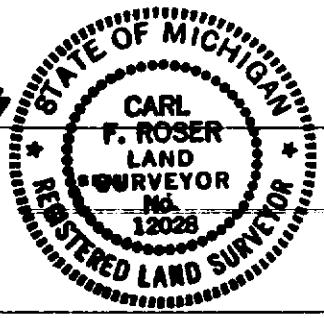

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ LEROY TOWNSHIP
 OSCEOLA COUNTY

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET