

SURVEY & REMONUMENTATION

DEC 13 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in <u>Osceola</u>	Located in:	Corner Code#
1. Public Land Survey	T 19 N R 7 W	E-1
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		

OSCEOLA COUNTY
REGISTER OF DEEDS
00 MAY -5 PM 2:51
Spencer Davenport

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on April 4, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

E-1 - Sec. cor. common to Sections 4 & 5, T19N, R7W & Sections 32 & 33, T20N, R7W - Township Line

A. Description of original monument and accessories and/or subsequent restoration:

1837 - J. Hodgson, G.L.O.
#1 - 7" Alder N68°E 23 Links
#2 - 30" Pine N88°W 502 Links

1889 - L. June, Co. Sur.
#3 - 2" Alder N57°E 11 Links
#4 - 2" Alder S28°W 22 Links

1891 - 1904 - F. Trumbull, Co. Sur.
Remonumentation of Townships
T19N R7W & T20N R7W
"Identified by B.T.'s & Tile".
#2 - 30" Pine N88°W 502 Links

1913 - Co. Sur. Twp. Notes
"Tile".
#5 - Elm N.W. 50.2'
#6 - Elm North 71'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found the 3" Clay Tile by Trumbull in a low swampy area. Corner is in line with old fence line to the South and in an extension of an old fence line from the east.


Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I set a 1" x 30" Pipe with Osceola County Remon Iron in the center of the Tile, and is accepted as a careful and faithful perpetuation of the position of the original corner.

P. Pole N68°E 446.46' (P.K. nail in N. side)
P. Pole S18°E 129.52' (P.K. Nail in E side)
6" Tri. Maple S75°E 417.54' (60d spike in S. side)
17" Maple S29°E 451.48' (60d spike in N.E. side)

APPROVED LAND CORNER
P.A. 345 OF 1990
Osceola County
R. L. Wetherell
4-20-2000

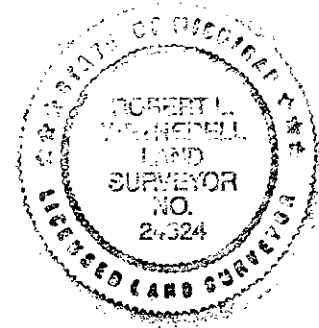

Signed by Robert L. Wetherell
Surveyor's Michigan License No. 24624

Date April 25, 2000