

**SURVEY &
REMONUMENTATION**

DEC 13 2000

SECTION LAND CORNER RECORDATION CERTIFICATE
FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

For corners in Osceola Located in: Corner Code#

1. Public Land Survey	T	19 N	R	7 W	E-9
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S	T	R		
	S	T	R		
3. Miscellaneous Property in Sec.	S	T	R		
	S	T	R		
4. Lot No. _____	Recorded Plat				
5. Private Claims					

Spencer Campbell
**OSCEOLA COUNTY
REGISTER OF DEEDS
00 MAY -5 PM 2:51**

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on March 29, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

E-9 - Section corner common to Sections 20, 21, 28 & 29, T19N, R7W

A. Description of original monument and accessories and/or subsequent restoration:

1856 - F. Coleman, G.L.O.

- #1 - 24" W. Pine N55°E 17 Links
- #2 - 14" W. Pine S85°W 20 Links

Undated Co. Sur. Twp. Book

- #5 - Fence Post S21 1/2 °W 43 1/3 Links
- #6 - Fence Post _____

1996 - R.L. Wetherell, LS 24624

- Found flat rock with "X" scribed on it.
- Found 3" tile under rock.
- Added 1/2" Iron.
- #7 - Maple Clump N63°W 36.52'
- #8 - 8" Maple S66°W 36.68'
- #9 - 6" Elm S26°E 27.59'
- #10 - Fence Post N4°E 32.7'

1891-1904 F. Trumbull, Co. Sur.

- "Identified by O.B.T".
- Set 3" Clay Tile with Cinders.
- #3 - 24" Pine S12°W 42 1/3 Links
- #4 - 20" Pine N37°W 42 1/3 Links

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:

I found a 1/2" Iron (I set in 1996) in center of 3" Clay Tile with Cinders. Corners are in line with fences North and South and in centerline of a seasonal road East and West.

Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Gone, #6 Gone, #7 Found in good condition, #8 Found in good condition, #9 Found in good condition, #10 Found in good condition.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1/2" rebar with a 1" x 18" Pipe with Osceola County Remon Cap, and is accepted as a careful and faithful perpetuation of the position of the original corner.

- Maple Clump N63°W 36.52' (60d spike in S. side) #7
- 9" Maple S66°W 36.68' (60d spike in S. side) #8
- 6" Elm S26°E 27.59' (60d spike W. side) #9
- Fence Post N4°E 32.7' (center) #10
- 8" Maple N79°E 56.05' (60d spike in S. side)
- 6" Maple S23°W 52.30' (60d spike in E. side)

APPROVED LAND CORNER
P.A. 345 OF 1990
Osceola County

R.L.W.
4-20-2000

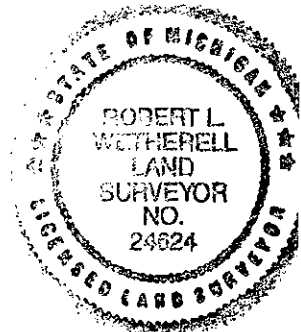

Signed by Robert L. Wetherell
Surveyor's Michigan License No. 24624

Date April 25, 2000