

**SURVEY & REMONUMENTATION**


DEC 13 2000

**LAND CORNER RECORDATION CERTIFICATE**

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in Osceola _____	Located in:	Corner Code#
1. Public Land Survey	T 20 N R 9 W	F-3
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____	R _____
	S _____ T _____	R _____
3. Miscellaneous Property in Sec.	S _____ T _____	R _____
	S _____ T _____	R _____
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		

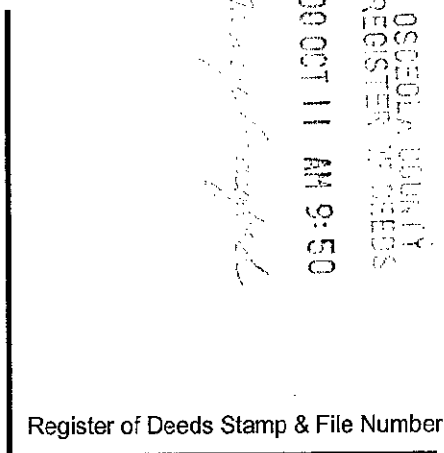

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on **June 5, 2000**, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**F-3 - 1/4 Corner common to Sections 4 & 9, T20N, R9W**

**A. Description of original monument and accessories and/or subsequent restoration:**

**1838 - J. Hodgson, G.L.O.**

- #1 - 5" Beech S11°W 8 Links
- #2 - 4" Beech N61°E 8 Links

**1904 - E. Trumbull, Co. Sur.**

- Co. Sur. Twp. Notes (Pg. 5)
- #3 - 14" Beech N42½°W 35 Links
- #4 - 36" Pine S37½°E 111 Links

**1999 - M. McClung, LS 13039**

- Survey rec. Liber 663, Pg. 935.
- #5 - 24" W. Pine S60°E 21.95'
- #6 - 24" W. Pine South 36.6'
- #7 - 5" Maple N25°W 17.05'
- #8 - 14" Maple North 52.7'

**1891-1904 - Temple/Trumbull/June**

Remonumented T20N, R9W with 3" Clay Tiles.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I found a 1/2" Iron in 3" Clay Tile at the intersection of fences North, South, East and West.

Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Found Stump, #5 Found in good condition, #6 Found in good condition, #7 Found in good condition (5" Beech), #8 Found in good condition.


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

I replaced the 1/2" iron with a 1" x 18" Pipe with Osceola County Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 5" Beech N21°W 17.05' (60d spike E. side) #7
- 24" W. Pine S36°E 22.47' (60d spike S.W. side) #5
- 12" Maple S73°W 48.35' (60d spike N. side)
- 14" Maple N6°E 52.70' (60d spike E. side) #8

APPROVED LAND CORNER  
P.A. 345 OF 1990  
Osceola County

R. L. W.  
8-17-2000

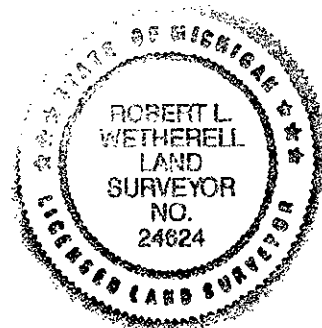

Signed by Robert L. Wetherell

Date August 22, 2000

Surveyor's Michigan License No. 24624

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN. 1983  
ADAPTED FOR WORD PROCESSING JANUARY, 1999