

FEB 24 2000

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in Osceola	Located in:	Corner Code#
1. Public Land Survey	T 20N R 8 W	I-2
	T R	
	T R	
	T R	
2. Property Controlling s in Section	T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____ Recorded Plat		
5. Private Claims		

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on September 30 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree Of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: ONLY ONE CORNER MAY BE RECORDED ON THIS CERTIFICATE

1/4 Corner common to Sec's 2 & 3

A. Description of original monument and accessories and/or subsequent restoration:

<u>1838 S. Sibley</u>	<u>1891- L. June</u>	<u>1923-1956 Highland Twp. Book</u>
Corner is 15" Maple	"Corner tree down identified by M.W. Stewart"	Pages 84 & 85
	Set 3" Clay Tile	Dist. North 4411.5'
		Dist. East 2706.30'

"SEE OVER FOR CONTINUATION OF A"

B. Description of corner evidence found and/or method applied in restoring of reestablishing corner:


I found an Osceola County Monument in line with the fence North and South and in the C/L of the East & West Road. The road at this location has been cut +/- 3 1/2'.

Condition of the accessories are as follow: #1 Gone, #2 Gone, #3 Found in good condition, #4 Found in good condition, #5 Found in good condition, #6 Found in good condition.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accept the 5/8" Re-Rod in monument box as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

N. End of Culvert N80W 225.0' - #3
 S. End of Culvert S80W 222.20' - #4
 3" Spruce S10W 57.32' (Nail on E Side) - #5
 P. Pole S50E 206.00' (Nail on SW Side)

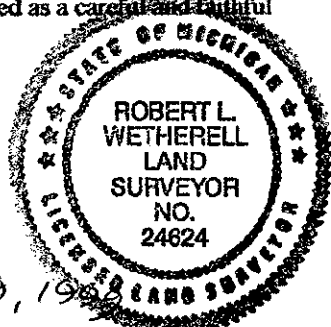

Signed by Robert L. Wetherell Date Nov. 9, 1999

Surveyor's Michigan License No. 24624

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 28, 1971
 REVISED MAY 14, 1976
 REVISED JAN., 1983
 ADAPTED FOR WORD PROCESSING JANUARY, 1999

APPROVED LAND CORNER
 P.A. 345 OF 1990
 Osceola County

10-21-99
RLW.

CONTINUATION OF DESCRIPTION OF THE ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT AND RESTORATION.

1981 M. McClung LS 13037

Recorded Survey
L 418, Pg 27
LCRC
L. 2, Pg 231
Fd. Plow Pt.
Set Iron & Cap
#1-24" Beech N10W 140.15'
#2-F. Post N05W 35.3'

SURVEY &
RECORDATION

FEB 24 2000

SECTION

OSCEOLA COUNTY
REGISTER OF DEEDS
99 NOV 19 PM 12:09

Mary Campbell

1998 M. McClung LS 13037

Unrecorded Survey
Fd. Iron & Cap
Set Osceola County Monument
#3- N End of Culvert N80W 225.00'
#4- S. End of Culvert S80W 222.20'
#5- 3" Spruce (Nail in E. Side) S10W 57.3'
#6- 6 P. Pole (Nail in SW Side) S50W 206.00'
Dist North 4415.11'
Dist. East 2706.26'