

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Ontonagon</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 46N R 39W	L2
	T 46N R 39W	M1
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Sep 29 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

(L2) Center of Section 1. Corner not established in the original survey. Found no subsequent record.

(M1) Corner of Townships 46-47 N, Ranges 38-39 W. Corner re-monumented in 1986 by R.L. Drahn, RLS # 21564 and recorded in Liber 2, Page 421, Ontonagon County Record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(L2) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/4 corners. The South 1/4 corner of Section 1 falls in the Bond Falls Flowage. It's unmonumented position was determined by proportionate measurement, according to the original record between the SW and SE corners of Section 1. At the position for the corner I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.

(M1) Recovered the 1986 monument, as described, in good condition, and at substantial record bearing and distance from the 1986 witnesses, all recovered. The Balsam NE has fallen over but still lives. Did not recover any remains of the original BIs noted in the 1986 record. Left the monument in place and marked two new witnesses as described below. Corner recovered and witnessed by B.Wheeler and D.Lampela, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(L2) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

7" Maple S63E 2.2' "C1/4 BT"

8" Hemlock S17W 23.6' "C1/4 BT"

8" Sugar S84W 26.8' "C1/4 BT"

6" Sugar N50E 18.9' "C1/4 BT"

Placed a squared post adjacent.

Bearings are magnetic. Distances to notch in lower blaze.

(M1) Found 2" dia. aluminum monument


with dia. 3 1/4" aluminum cap #21564.

Blazed and scribed the following:

3" Maple N44E 26.1' "S31 MBT"

15" Spruce N33W 14.7' "S36 MBT"

Bearings are magnetic. Distances are to notch in lower blaze.

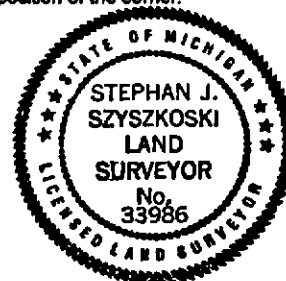

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 2/18/98

For the Michigan Department of Natural Resources - Forest Management Division