| BUHNEY     |  |
|------------|--|
| DREMONDIEN |  |
|            |  |

For comers in

DEC 1 6 1996 COMMISSION JUDITH D. ROEHM
Ontonason Counts
LC 4/ 91 JEM Fee:

07/11/96 08:44

9.00

Page 1 of 1

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970


| ONTONAGON (County)   | Located In:                            | Corner Code # |
|--|--|---------------|
| 1. Public Land Survey  | T <u>47</u> NR<br>T <u>48</u> NR<br>TR | 40W G-13      |
| Property Controlling     in Section     Miscellaneous     Property in Sec. | S TR<br>S TR<br>S TR<br>S TR           |               |

Register of Deeds Stamp & File Number

Section Corner common to Section 3 & 4, T47N R40W & 33 & 34, T48N R40W.

[Earl W. Applekamp], in a field survey on May 15, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

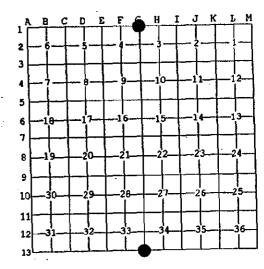

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established by John Burt, U.S. Deputy Surveyor, July 13,11850. Set Sugar Post.

ORIGINAL BEARING TREES:

reference objects.

Sugar 8" N52°E 13 links W. Pine 18" N53°W 29 links COUNTY REPRESENTATIVE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

07-08-96

No original evidence was found. Corner was re-established by using existing evidence such as fence running East, 33 feet South of the corner position. A 66' roadway appeared to have been cleared North of this fence line. The original call to a stream South is in conformance with the re-established location of the corner. The occupational lines are in agreement. The gravel road has been in existence for 60 plus years. The corner was set in the only logical position.

Research on file with the Ontonagon County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position I set 5/8"X24" rebar with a 3½" stamped cap
6" below the top of gravel in the center of the road. I established
one reference monument which is a 2½"X30" aluminum pipe with a 3½"
cap stamped to read: County Remonumentation, T48N, T47N, R40W, S33,
S34, S3, S4, 1996, P.S. 17610. I also established three other

REF. MON. N89°-33'-06"E 36.72' - 6" Aspen N28°-55'-07"W 68.74' REA P. Pole S66°-18'-01"W 33.59' - 7" Maple-twin N25°-34'-24"E 105.05'

EARL W. A
APPLEKAMP
PROFESSIONAL
SURVEYOR
NO.
17610
POFESSIONAL
A
POFESS

Signed by Jarl W Applikangs
Surveyor's Michigan License No. 17610