RECORDING FEE:

9,00

LAND CORNER RECORDATION CERTIFICATE Ontonason County

Filling Requirement of Act 74, Mich. P. A. 1970 f 🚶 Ontonagon County Remonumentation Cornerec. Date 08/03/98 Time 09:22

L(

For corners in

Ontonagon County		Located in:		Comer Code #	
1. P	ublic Land Survey	T51N	R37W	K-11	
	-		T	R	
	·		T	R	
			T	R	
2. P	roperty Controlling	S	T	R	•
	Section	S	T	R	
3. N	liscellaneous	S	T	R	
P	roperty in Sec.	S	т .	R	

. 177 J. 1959

STOTION

Register of Deeds Stamp & File Number


Lot No.

, Recorded Plat

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on July 9, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules their firm as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

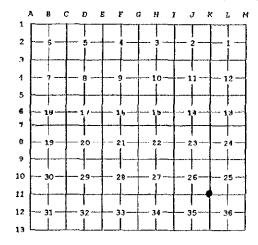

A. Description of original monument and accessories and/or subsequent restoration:

(K-11) Corner Common to Sections 25, 26, 35 & 36, T51N, R37W

1846 - Sylvester W. Higgins set post

20" Y. Birch N 60° W

22 links

18" Sugar

\$ 55° E

39 links

1976 - Keith L. Sackett, R.L.S. 19006 for Michigan Department of Natural Resources, re-established this corner by double proportionate measurement. He set a 1" I.D. x 36" iron pipe with a 4" aluminum cap on a North-South fenceline. This corner is recorded in the Ontonagon County Register of Deeds Office, Liber 1, Page 55 of

Corner Records. He established 3 NBTs:

9" Y. Birch

\$ 51° W

6.5

6" Maple

S 52° E

5.4'

7" Ash

N 55° W

9.3

B. Description of comer evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original comer or accessories. I recovered the comer re-established by Sackett, as well as his 3 NBTs. It falls in the North-south fenceline as mentioned by Sackett. Interior 1/16 fences in the Section work reasonably well with this position. This corner has been used and accepted by surveyors and land owners for over 20 years. Therefore I have accepted it as the Northeast Corner of Section 35.

Research on file with County Remonumentation Representative.

C. Description of monument for comer and accessories established to perpetuate locating the position of the corner:

Corner is a 1" I.D. x 36" iron pipe with a 4" diameter aluminum cap stamped to read; MICHIGAN DEPT, OF NATURAL RESOURCES; 26, 25, 35, 36, T51N, R37W, 7/22/76; RLS 19006.

Witnesses:

12" Y. Birch N 68° E 23.33" 7" Soft Maple S 52° E 5.66' (DNR, added nail) S 53° W 12" Y. Birch 7.14 (DNR, added nail) 8" Ash N 50° W 9.56 (DNR, added nail) Steel Sign Rail 0.88' North (to face) E 1/4 Cor. Section 35 S 01° 49' 09" W 2666.91

S 89° 30' 01" W

JOSEPH DOMITROVICH LÄND SURVEYOR CAND

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

2619.76

Signed by (

N 1/4 Cor. Section 35