

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>51</u> ^{N.} / _{X.} , R. <u>40</u> ^{X.} / _{W.}	<u>J-7, H-9, I-10</u>
2. PROPERTY CONTROLLING IN SECTION <u>23</u>	, T. <u>51</u> ^{N.} / _{X.} , R. <u>40</u> ^{X.} / _{W.}	<u>1</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ ^{N.} / _{S.} , R. _____ ^{E.} / _{W.}	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on See below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner J-7: Original monument and accessories not found. Found fence corner on north edge of woods road.

Corner H-9: Original monument and accessories not found. Found 12" bolt with 1" square head in county road. Corner falls between fence corners north and south.

Corner I-10: Original monument and accessories not found. Found 1" square steel pin in old road bed pointed out by Stanley Fraser, a lifelong local resident.

Corner 15: Not set on original survey nor subsequently apparently. Found old fence to the north.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner J-7: Reestablished 8/4/76 21 feet south of fence corner in line with fence north.

Corner H-9: Reestablished 8/12/76 at bolt location.

Corner I-10: Reestablished 8/12/76 at location of steel pin.

Corner 15: Corner set on line between quarter corner E and section corner W in line with fence N. Established 8/4/76.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<u>Corner J-7:</u> Set 1" I.D. x 24" iron pipe with	<u>Corner I-10:</u> 1" square steel pin in old road bed.
6" Elm N77°E 53.5' 1/4S, NBT	6" Aspen N23°W 60.8' 1/4S, NBT
6" Elm S12°W 21.3' 1/4S, NBT	An old gate post S02°W 5.5'
6" Elm N72°E 20.2' 1/4S, NBT	
6" Elm S72°E 26.5' 1/4S, NBT	

<u>Corner 15:</u> 12" bolt with 1" square head.	<u>Corner 15:</u> Set 1" I.D. x 36" iron pipe with
6" Elm S33°E 36.5' 1/4S, NBT	4" aluminum cap. Corner falls in north shoulder
6" Elm S61°W 61.9' 1/4S, NBT	of county road.
6" Elm corner post N2°E 32.4'	9" Aspen N37°W 54.3' 1/16 S, BT
	7" Maple N21°E 85.8' 1/16 S, BT
	Fence corner, N17'


SIGNED BY _____ DATE _____

 SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

 ON STATE AND UNITED STATES AGENCIES:

 DATED BY _____ DATE _____

 APPROVED AND SIGNED BY Keith L. Sackett CHIEF OF SURVEY PARTY DATE 8/30/76
 MICHIGAN REGISTERED LAND SURVEYOR
 Keith L. Sackett

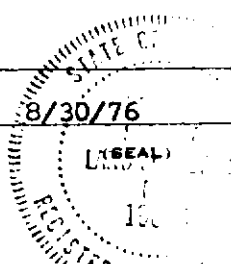

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET