

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in Ontonagon Located In: \_\_\_\_\_ Corner Code # \_\_\_\_\_  
 (County)

1. Public Land Survey	T	51N	R	40W	H-1
	T	_____	R	_____	_____
	T	_____	R	_____	_____
	T	_____	R	_____	_____
2. Property Controlling in Section	S	_____	T	_____	_____
	S	_____	T	_____	_____
3. Miscellaneous Property in Section	S	_____	T	_____	_____
	S	_____	T	_____	_____

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

**SURVEY & REMONUMENTATION**

MAY 22 1997

**COMMISSION**

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Joseph C. Domitrovich, in a field survey on August 5, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

(H-1) North 1/4 Corner Section 3, T51N, R40W

Corner was not set in the original survey, but established midway and on line between closing corners.

1979 - Robert Mick P.S. 16936 in survey for Ontonagon county Airport (on file at Ontonagon County Register of Deeds in Plat files), set a concrete monument by single proportionate measurement between closing corners to East and West. He did not note any witnesses to the set corner. He did note that the corner fell 38.94' east of the South 1/4 corner Section 34, T52N, R40W.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

I found a 6" diameter concrete monument as called for in Mick Survey. It works well with found Monuments to the east and west. I accepted the concrete monument as the North 1/4 corner of Section 3 and placed a 2" diameter stamped cap on it.

Research on file with County Remonumentation Representative.


**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Corner is a 1/2" iron rod encased in concrete capped with a 2" diameter aluminum cap stamped to read: T.51N., R.40W.; 1/4 S.3; 1996; P.S. 37273. Corner falls 20' south of an old driveway and 38.86' east of South 1/4 corner Section 34, T52N, R40W.

**Witnesses:**

Anchor Pole	N 35° E	42.86'
Steel Sign Post	East	1.21'
6" Poplar	S 75° E	11.00'
4" Hard Maple	S 11° W	6.91'
5/8" rebar with 3" aluminum cap	West	38.86' (S. 1/4 Corner Section 34)

PEER GROUP APPROVED  
*Earl W. Applekamp*  
 COUNTY REPRESENTATIVE 08-08-96

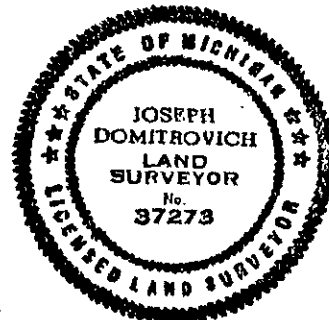

**NOTE: Bearings are magnetic. Distances are to nail in side of witness objects unless noted.**

Signed by Joseph C. Domitrovich

Date 8/8/96

Surveyor's Michigan License No. 37273