1P

LAND CORNER RECORDATION CERTIFICATE Untenasion County

Filling Requirement of Act 74, Mich. P.Aa4970 of 1

5/ 63

Time 10:45

Ontonagon County Remonumentation CornerRec. Date 05/26/98 RECORDING FEE:

R

R

Time 10:45 9.00

For corners in Corner Code # Located in: **Ontonagon County** T51N R41W K-5 1. Public Land Survey

T

T

ĪF JUDITH D. RUEHN Outcommon County Page 1 of 1 LC 37 63

Rec. Date 05/26/98

T R 2. Property Controlling S T R R T in Section S R 3. Miscellaneous S T Property in Sec. S

RECORDING FEE: SURVEY REMONUMENTATION

THE

9.00


Register of Deeds Stamp & File Number

4. Lot No. 5. Private Claims

, Recorded Plat

SECTION

JAN 11 1999

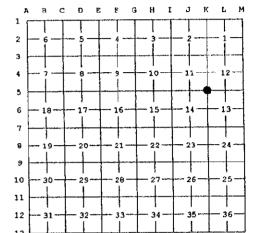

1, Joseph C. Domitrovich, in a field survey on March 6, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Corner of Sections 11, 12, 13 and 14, T51N, R41W

1846- S.W. Higgins set a post:

15' Hemlock N50°E 28 links

42" Sugar S35°W 50 links

I found no other record of subsequent restoration.

B. Description of comer evidence found and/or method applied in restoring or reestablishing corner:

The original corner and accessories have been destroyed by farming and logging activity since the turn of the century. In the area of the corner I found the remains of an old homestead clearing, a very old North-South fence and extensive clearcut logging to all sides. Distances between 1/2 corners and Section corners in this section are very long and distances measured to existing streams vary considerably from record GLO calls. I believe this is the result of either gross error or fraudulent work on the part of the original Government Surveyor.

I reestablished the corner position by proportionate measurement, holding the old North-South Fence for the Departure and a position midway and on line between 1/2 corners to the north and south for the Latitude. I believe the position I have placed the corner at to be the best and most equitable position for the corner and have monumented it as such.

Research on file with County Remonumentation Representative.

C. Description of monument for comer and accessories established to perpetuate locating the position of the corner:

Corner is a 5/8" x 24" iron pin driven into the old North-South fenceline with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T51N, R41W; S.11, S.12, S.13, S.14; 1998; P.S. 37273.

Witnesses:

N1/4 Cor. Sec. 13

W1/4 Cor. Sec. 13

N44°E 31.65 4" Hemlock 1.41' (to face) East Steel Sign Post 8.92 S11°W 5" Poplar 3.87 N42°W 5" Poplar 2786.20 W1/4 Cor Sec. 12 N00°54'29"E

S88°30'26"E 2805.92 2786.94 S01°08'33"E

PEER GROUP

COUST

NOTE: Bearings are magnetic. Distances are to a nail in side of the witness object unless noted.

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1871 REVISED MAY 14. 1875 REVISED JAN., 1883 REVISED OCT., 1895

MICHIO

JOSEPH

LAND SURVEYOR

CARD

MITROVICH

LCRC T51N R41W K-5.doc