

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

St. Joseph <small>(County)</small>	Located In:	Corner Code - <i>11</i>
1 Public Land Survey	T <i>7S</i> R <i>12W</i>	<i>C-4, C-3, B-3</i>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2 Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3 Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4 Lot No. _____, Recorded Plat _____		
5 Private Claims _____		

Register of Deeds Stamp & File Number

I, Donald L. Bissell, in a field survey on October, 19 89, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3	7	8											
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A Description of original monument and accessories and/or subsequent restoration:

C-4 G.L.O. Witnesses 11" W. Oak - S30°E - 24 lks 11" W. Oak - N18°W - 1.22 lks.	C-3 D. Scott, 1-60 Set 1" Pipe w/brass cap N76°W - 51.03' - 38" W. Oak N28° 30' E - 50.48' - Group of 6 Maples S52°E - 41.88' - 26" Walnut S43°E - 67.00' - NW Cor. porch S29° 45' W - 19.38' - 7" Tamarac	B-3 G.L.O. Witnesses 12" Y. Oak - S63°W - 75 lks. 14" W. Oak - N50°E - 26 lks
---	---	---


B Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-4 E 1/4 Cor. Sec. 7 Set 4" x 36" Conc. Mon. in center of old rotted fence corner post at intersection of very old North-South and West fence.	C-3 NE Cor. Sec. 7 Found stone w/5/8" rod on E. side S52°E - 41.88' - stump S43° 45' E - 67.00' NW Cor. porch S29° 45' N - 19.38' stump	B-3 N 1/4 Cor. Sec. 7 Found stone in mon. box
--	---	--

C Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-4 E 1/4 Cor. Sec. 7 4" x 36" Conc. Mon. w/alum cap S88°E - 15.21' - Twin 6" Maple S20°E - 11.96' - 6" Ironwood S70°W - 21.98' - 6" maple N01°E - 18.95' - 12" Beech South - 42' - Center trail Halfway down N. side hill trees blazed, Spike & Tags	C-3 NE Cor. Sec. 7 Stone w/ 5/8" rod on E. side S68°E - 89.0' - 24" Maple S78°W - 72.4' - 11" R. Oak N32°W - 54.7' - Power pole Spike & Tags in trees & pole	B-3 N 1/4 Cor. Stone in mon. box N39°E - 47.6' - RD sign N77°E - 95.45' - 5" W. Oak S18°E - 59.63' - 14" Walnut N56°W - 68.49' - 3" B. Oak Spike & Tags in trees
---	---	--

Signed by Donald L. Bissell Date _____
 Surveyor's Michigan License No. 18655

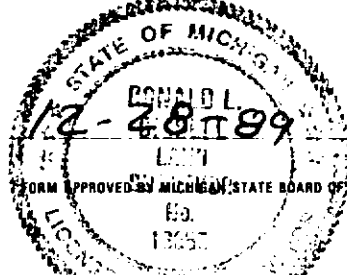

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983