

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Schoolcraft Co. Four Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. _____ N. _____ S. _____ R. _____ E. _____ W. _____		6, Sec. 5 - 9, Sec. 5 Cor. "A", Sec. 5 Cor. "B", Sec. 5
2. PROPERTY CONTROLLING IN SECTION <u>5</u> T. <u>41</u> N. _____ S. _____ R. <u>13</u> E. _____ W. _____		
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. _____ S. _____ R. _____ E. _____ W. _____		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		


REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 5/14 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

- A. Description of original monument and accessories and/or subsequent restoration:**
- 6, Sec. 5 West 1/16 Corner, Sec. 5.
 - 9, Sec. 5 East 1/16 Corner, Sec. 5.
 - Cor. "A", Sec. 5 Corner, on E-W line, on East edge of lake, bet. Gov't lots #2 and 3.
 - Cor. "B", Sec. 5 Corner, on North 1/16 line, on East edge of lake, bet. Gov't lots #2 and 3.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**
- 6, Sec. 5 Corner placed at intersection of lines, quartering the N.E. quarter sec.
 - 9, Sec. 5 Corner placed on E-W line, according to rules for proper sub-division of fractional sections.
 - Cor. "A", Sec. 5 Corner placed on E-W line, 21.9' West of the East 1/16 Corner.
 - Cor. "B", Sec. 5 Corner placed, on North 1/16 line, 28.0' East of lake.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**
- 6, Sec. 5 Placed 1" pipe with Brass cap at corner.
Bearings: 4" W. Birch, N55°E, 1.5' and 5" W. Birch, S14°W, 22.0'
 - 9, Sec. 5 Drove 5/8" x 3/8" iron at corner.
Bearings: Corner lies 21.9' East of Dept marker, on E-W line, at edge of lake.
 - Cor. "A", Sec. 5 Placed 1" pipe with 4" aluminium cap at corner.
Bearings: 7" W. Birch, N63°W, 10.4' and 10" W. Birch, N80°E, 37.9'
6" Well, N70°E, 93.2' and East 1/16 Cor., East, 21.9'
 - Cor. "B", Sec. 5 Placed 1" pipe with 4" aluminium cap at corner.
Bearings: 8" R. pipe, N48°W, 84.5'

SIGNED BY Billy D. Buckler DATE 9/26/73

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

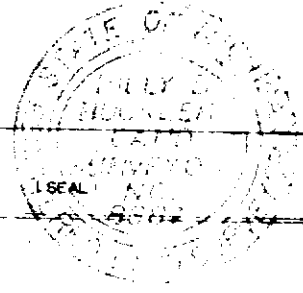

FOR STATE AND UNITED STATES AGENCIES:
SIGNED BY _____ CHIEF OF SURVEY PARTY DATE _____

APPROVED AND SIGNED BY _____ MICHIGAN REGISTERED LAND SURVEYOR DATE _____ (SEAL)