

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Schoolcraft

(County)

Located In:

Corner Code #

**1. Public Land Survey**

T43N R 14W      A3  
 T43N R 14W      C3

**2. Property Controlling in Section**

S \_\_\_ T \_\_\_ R \_\_\_

**3. Miscellaneous Property in Sec.**

S \_\_\_ T \_\_\_ R \_\_\_  
 S \_\_\_ T \_\_\_ R \_\_\_

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Aug 04 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3	•	•										
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**A. Description of original monument and accessories and/or subsequent restoration:**

(A3) Closing corner common to Sections 6-7. Reestablished in 1961 by Billy D. Buckler, RLS: "This corner was re-established 2.00 chains (record distance) north of Sections corner 1-12, T43N-R15W". 1" pipe with 4" brass cap. 8" J.Pine N62E 11.5 links, 8" J.Pine S25E 24 links.

(C3) Corner common to Sections 5-6-7-8. Reestablished by proportionate measurement in 1961 by Billy D. Buckler, RLS. 1" pipe with 4" brass cap. 7" J.Pine S18W 4.5 links, 9" J.Pine S02W 39 links.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(A3) Recovered the 1961 monument as described, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1961 accessories, now both dead but still standing and with scribe marks visible. Left the monument in place and marked 4 new witnesses as described below.


(C3) Recovered the 1961 monument as described, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition. The 1961 witnesses have both been cut. Left the monument in place and made 4 new accessories as described below.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(A3) Found 1" pipe with 4" brass cap. Blazed, scribed, and set measuring nails in the following:

6" Spruce N15E 28.05'      "S6 N8T"  
 6" J.Pine N37E 37.1'      do  
 10" J.Pine S42E 44.55'      "S7 N8T"  
 10" J.Pine S34E 42.15'      do  
 Bearings are magnetic. Distances are to nail with tag.

(C3) Found 1" pipe with 4" brass cap. Made 8H and base blazes (not scribed) and set measuring nails in the following new bearing trees:  
 3" J.Pine N02E 38.2'  
 3" J.Pine N25W 43.6'  
 3" J.Pine S04E 30.0'  
 3" J.Pine N69E 21.6'  
 Bearings are magnetic. Distances to nail with tag.

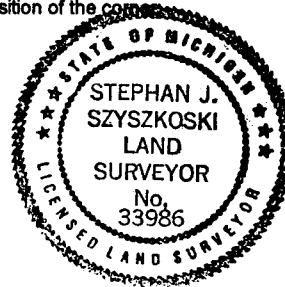

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 5/3/00

For the Michigan Department of Natural Resources - Forest Management Division