

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Schoolcraft</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>15W</u>	<u>I6</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u>23</u> T <u>43N</u> R <u>15W</u>	<u>8</u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

8 Dec 15 1998
 I6 Jun 15 1999

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												


A. Description of original monument and accessories and/or subsequent restoration:
 (16) Quarter corner common to Sections 14-15. Reestablished by single proportionate measurement to the original record in 1972 by F.J. Bray, RLS. 1" iron pipe with 4" aluminum cap. 10" R. Maple S87W 4.4', 21" Hemlock S36E 11.3'.
 (8-Sec. 23) West 1/16 corner, Section 23. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(16) Recovered the 1972 monument as described, in good condition, and at record bearing and distance from the 1972 witnesses. The R.Maple is standing but dead. The hemlock is in good condition. Left the monument in place and marked three new witnesses as described below.
 (8-Sec. 23) Established the corner midway and on a straight line between Quarter corner 1323.38' west and Center of Section 1323.38' east. At the position for the corner, I placed a 1" ID x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(16) 1" pipe with 4" aluminum cap. Blazed, scribed, and set measuring nails in the following: 8" Beech N54W 11.8' "1/4S NBT" 6" Hemlock N30W 18.3' do 6" Hemlock N33E 13.8' do The 1972 witness: 34" Hemlock S38E 12.4' Bearings are magnetic. Dist to nail with tag. Set 3" post adjacent.	(8) 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following: 10" Maple North 2.05' "W1/16 8T" 14" Hemlock N75W 15.75' do 8" Maple N16W 36.75' do 3" Balsam N46E 11.8' do Bearings are magnetic. Dist. to nail w/tag. Placed squared and scribed cedar post adjacent.
---	---

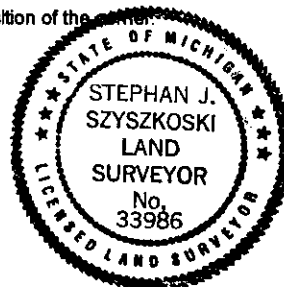

Signed by Stephan J. Szyszkoski Date 3/21/00
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division