


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

<u>Schoolcraft</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>16W</u>	<u>K5</u>
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims		

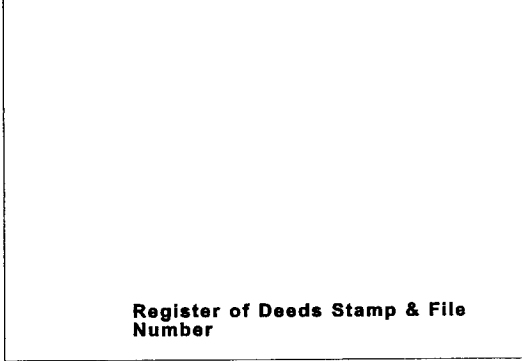

I, Stephan J. Szyszkoski, in a field survey on Feb. 26, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5										●		
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 (K5) Corner common to Sections 11-12-13-14. 1850 - Established by A.Merryweather, Deputy Surveyor. Monument not specified. Bearing trees: Tamarack 7 S75E 24 links, Tamarack 8 N39W 33 links. 1961 - Reestablished by Billy D. Buckler RLS: This corner was replaced from one Tamarack B.T. in good condition bearing S75E 24 links. Tamarack is a shattered stub. Set 1" pipe with 4" brass cap. New bearing trees: 6" Tamarack N15W 73 links, 6" Cedar N86W 55 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 (K5) Recovered the 1961 monument in good condition and at record bearing and distance from the remaining 1961 NBT Tamarack, now dead. The Cedar NBT was not recovered. Accepted the monument as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 (K5) Found 1" ID I.pipe with 4" brass Michigan Dept. of Conservation cap. Set measuring nail with MDNR tag in the side of the following trees:
 6" Cedar S76W 37.5' mrkd "S14 NBT"
 6" Cedar S40W 32.55' "S14 NBT"
 9" twin Cedar N50E 83.2' "S12 NBT"
 7" Cedar N82E 77.8' "S12 NBT"
 Bearings are magnetic.



Signed by Stephan J. Szyszkoski Date 11/1/07

Surveyor's Michigan License No. 33986