


**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970 as Amended**

For corners in

<u>Schoolcraft</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T43N R 16W	L3
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims		

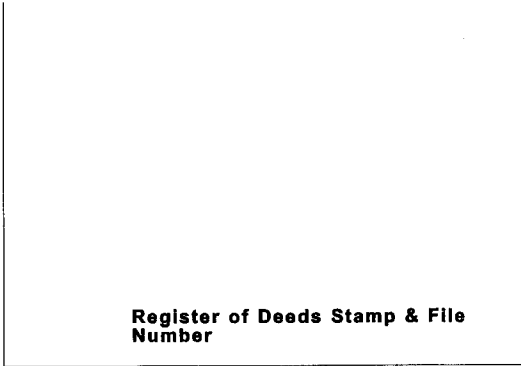

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Stephan J. Szyszkoski, in a field survey on Oct. 24, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:  
(L3) Quarter corner common to Sections 1 and 12. 1850 - Established by A.Merryweather Deputy Surveyor midway and on the Section line between Section corners 40.00 chains east and west. Set post in river. Bearing tree B.Ash 12 S80W 70 links. Merryweather details five crossings of the Stuttts creek along this line, the corner post having been set in the most easterly of the five. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
(L3) The original post and accessory were not recovered. Found no evidence of the GLO line trees along the line between Sections 1 and 12. Found no acceptable evidence of the position of the original corner on the ground. The distance between reestablished section corners east and west was found to be 5350.23', 70' longer than the GLO record. I note that from reestablished K3 the westerly three of the five creek crossings check very well with the GLO record at both banks. The easterly two of the creek crossings do not check and are between 61' and 72' longer than the GLO record when measured from the Section corner at the NE corner of Section 12. I conclude that there was a blunder of 1 chain in the original measurement of the line between Sections 1 and 12 and that it occurred in the vicinity of the Quarter corner. Therefore I reestablished L3 at the index-corrected record distance of 2648.2' west of M3 and on the Section line between M3 and K3. The index correction (+8.2' per 1/2 mile) was derived by averaging 8 miles of observed E-W lines in this township. The position for the corner falls in a trail which has been bulldozed across the ancient bed of the Stuttts creek (now a slough).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
(L3) Set 1"IDx48" I.pipe with 4" brass Michigan Dept. of Conservation cap. Set measuring nail with MDNR tag in the side of:  
11" R.Pine S83E 73.00' mrkd "1/4S NBT"  
23" R.Pine N22E 45.19' do  
5" Maple N01W 54.34' do  
10" Cedar S55W 49.42' do  
Set carsonite post 1.0' north.  
Bearings are magnetic.



Signed by Stephan J. Szyszkoski Date 11/1/07

Surveyor's Michigan License No. 33986