


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Schoolcraft	Located In:	Corner Code #
(County)		
1. Public Land Survey	T 44N R 15W	D13
	T 44N R 15W	C9
	T R	
2. Property Controlling in Section	S T R	
	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

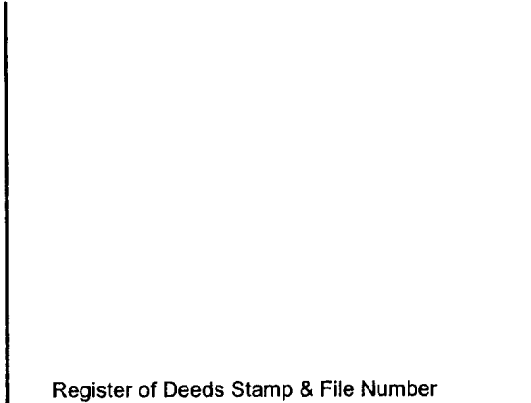

I, Stephan J. Szyszkoski, in a field survey on D13 07/28/2009 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(D13) Quarter corner common to Section 32 T44N-R15W and Section 5 T43N-R15W. 1969 - F.J.Bray, RLS Reestablished the corner by single proportionate measurement to the original record between Section corners east and west. Set 1" Iron pipe with 4" aluminum cap. 12" W.Pine N03W 28 links, 16" W.Pine S06E 25 links.

(C9) Corner common to Sections 19-20-29-30. 1965 - Remonumented by F.J.Bray RLS at record bearing and distance from OBT W.Pine 12" S58E 35 links. Set 1" ID I.pipe with 4" aluminum cap. 14" Red Pine S69 1/2W 6.5 links, 14" W.Pine N37E 53 links, 6" Jack Pine S78 1/2E 18 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(D13) Found the 1969 monument in good condition and at record bearing and distance from the 1969 NBTs, both in good condition. Accepted the monument as a careful and faithful reestablishment of the position of the original corner.

(C9) Found the 1965 monument in good condition and at record bearing and distance from the stump remains of the 1965 witnesses, all of which have been cut. Accepted the monument as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(D13) Found 1" ID I.pipe with 4" alum. cap
 Set measuring nail with MDNR tag in the side of:
 21" W.Pine North 19.5' 1969 NBT
 19" W.Pine S05E 16.6' do
 14" R.Pine N28W 32.9' mrkd "1/4S NBT"
 24" W.Pine N86W 21.95' do
 Bearings are magnetic.

(C9) Found 1" ID I.pipe with 4" alum. MDNR cap.
 Set measuring nail with MDNR tag in the side of:
 11" R.Pine S57E 34.2' mrkd "S29 NBT"
 13" R.Pine N54E 47.7' "S20 NBT"
 12" W.Pine N60W 14.95' "S19 NBT"
 10" J.Pine S41W 26.35' "S30 NBT"
 Bearings are magnetic

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 01/26/2010

For the Michigan Department of Natural Resources, Office of Land and Facilities

