

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft
(County)

Located in:

Corner Code #

1. Public Land Survey	T 46N R 13W	613
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Aug 14 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:
(613) Corner common to Sections 33-34 T46N-R13W and 3-4 T45N-R13W. Corner re-monumented in 1935 by U.S.D.A. Biological Survey. Recorded in 1970 by Billy D. Buckler, RLS: 1" pipe with 4" aluminum cap and bronze plaque in concrete monument, "U.S. Dept. of Agriculture, Biological Survey". Witnesses to corner: 10" Cedar N10W 40.3', 9" Cedar N58E 24.8'. The corner is shown on a USBS map "Seney Migratory Waterfowl Refuge" dated Dec. 1936. Distances West and South to adjacent Section corners are shown: 79.98 ch. and 80.21 ch. respectively. No witnesses or explanatory field notes were available from the U.S. Fish and Wildlife Service.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(613) Recovered the 1970 monument as described, a concrete U.S. Biological Survey monument capped with a brass tablet with a 1" iron pipe capped with a 4" dia. cast aluminum MNR tablet, projecting above the concrete monument, in good condition, and at record bearing and distance from the 1970 Cedar 8Ts. The Cedar N58E was found in good condition. The Cedar N10W is now a cut stump. Left the monument in place and marked new witnesses as described below. Corner recovered and re-witnessed by T.Stark, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


(613) Found 1" pipe with 4" MNR cap projecting above USBS concrete monument. Blazed, scribed, and set measuring nails in the following:

Cedar N61E 25.25' "S34"
4" Balsam N51E 19.1' "S34 NBT"
8" Tamarack N80E 34.9' "S34 NBT"
10" Tamarack S61E 26.15' "S3 NBT"

Placed a 3" squared and scribed cedar post adjacent. Bearings are magnetic. Meas. are to the USBS mon.

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 8/27/98

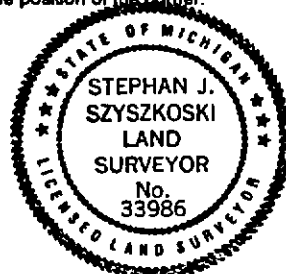

For the Michigan Department of Natural Resources - Forest Management Division