

60

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft (County)	Located in:	Corner Code #
1. Public Land Survey	T 46N R 13W	112
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S 34 T 46N R 13W	7
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Aug 21 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

(112) Quarter corner common to Sections 34-35. Corner reestablished in 1963 by M.Sperhake, RLS, midway and on a line between Section Corners 39.91 chains North and South. Monument: 1"x3" galvanized iron pipe with aluminum Kimberly-Clark Corp. cap. 1963 witnesses: Tamarack 7 N33E 28.5 links, Spruce 6 S45W 61.5 links.

(7-Sec. 34) North 1/16 corner between Sections 34-35. Corner established in 1963 by M.Sperhake, RLS. Monument: 1"x3" galvanized iron pipe with aluminum cap "Kimberly-Clark Corp." Witnesses: Spruce 6 N33W 18 links, Spruce 7 N55E 20 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(112) Recovered the 1963 monument as described, in good condition, and at record bearing and distance from the 1963 Tamarack N8T, found in good condition. The Spruce is now gone. Recovered the monument 1.3' West and 0.3' South of the intended 1963 position and accepted the monument as a careful and faithful reestablishment of the position of the original corner. Left the monument in place and marked new witnesses as described below. Corner recovered and witnessed by T. Stark, Newberry District Office.

(7-Sec. 34) Recovered the 1963 monument, as described, in good condition. The 1963 witness trees are both gone. Verified the position of the monument by surveying north and south to Section and Quarter corners and determined that the monument as recovered is 0.08'E and 2.38' N of the intended 1963 position. I judge that the monument has not been disturbed from its 1963 position and I accept the monument as a careful and faithful determination of the position of the corner. Left the monument in place and marked new witnesses as described below. Corner recovered and witnessed by T.Stark, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(112) Found 1" pipe with 4" Kimberly-Clark cap. Blazed, scribed, and set measuring nails in:
6" Spruce S47E 3.8' "1/4S NBT"
10" Tamarack S72W 25.2' "1/4S NBT"
6" Spruce N24W 5.65' "1/4S NBT"
12" Tamarack N35E 19.5' "1/4S"
Placed a 3" squared and scribed cedar post adjacent. Bearings are magnetic.

(7) Found 1" pipe with 4" Kimberly-Clark cap. Blazed and scribed the following new bearing trees:
4" Tamarack N34W 6.75' "N1/16 BT"
5" Tamarack S30W 18.8' "N1/16 BT"
6" Tamarack S34E 27.8' "N1/16 BT"
4" Tamarack S47E 8.3' "N1/16 BT"
Placed a 3" cedar post adjacent. Bearings are magnetic.

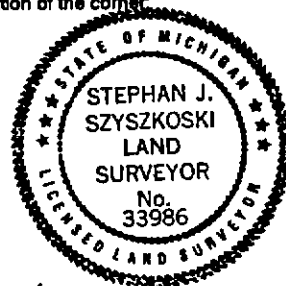

Signed by _____

Stephan J. Szyszkoski

Date _____

8/27/98

Surveyor's Michigan License No. _____

33986

For the Michigan Department of Natural Resources - Forest Management Division