

61

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft

(County)

Located in:

Corner Code #

1. Public Land Survey

T ___ R ___
T ___ R ___
T ___ R ___
T ___ R ___

2. Property Controlling
in Section

S 34 T 46N R 13W 10
S 34 T 46N R 13W 16

3. Miscellaneous
Property in Sec.

S ___ T ___ R ___
S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Aug 11 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


(10-Sec. 34) South 1/16 between Sections 33-34. Corner established in 1970 by Billy D. Buckler, RLS. Buckler placed a 1" pipe with 4" aluminum cap and marked the following: 7" cedar S60E 20.8', 9" Cedar N43W 12.8'
(16-Sec. 34) East 1/16 corner between Section 34 T46N-R13W and Sec. 3 T45N-R13W. Corner established in 1970 by Billy D. Buckler RLS, midway between Section corner East and Quarter corner West. Monumented with a 1" iron pipe with 4" aluminum cap. 1970 witnesses are 18" Y. Birch N72W 6.6', and 12" Soft Maple S14W 9.2'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(10-Sec. 34) Found the 1970 monument, as described, in good condition, and at record bearing and distance from the remaining bearing tree Cedar N43W, recovered as a 3' high cut stump. The Cedar S60E was not recovered. Left the monument in place and marked 4 new accessories as described below. Corner recovered and re-witnessed by T.Stark, Newberry District Office.
(16-Sec. 34) Recovered the 1970 monument as described, in good condition, and at record bearing and distance from the two 1970 witness trees. I determined the monument to be 2.37' East and 0.7' South of the position intended in 1970 and I accepted same as a careful and faithful determination of the position of the corner. Left the monument in place and marked new witnesses as described below. Corner recovered and re-witnessed by T.Stark, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(10) Found 1" pipe with 4" MONR cap.	(16) Found 1" pipe with 4" MONR cap.
Blazed, scribed, and set measuring nails in the following:	Blazed, scribed, and set measuring nails in the following:
6" Cedar N11E 15.9' "S1/16 BT"	24" Y. Birch N67W 6.45' "E1/16 BT"
7" Cedar N29W 15.5' "S1/16 BT"	18" Soft Maple S18W 8.75' "E1/16 BT"
4" Tamarack S79W 26.95' "S1/16 BT"	20" Y. Birch N74E 13.2' "E1/16 BT"
5" Cedar S67W 28.9' "S1/16 BT"	12" Hemlock S57W 25.6' "E1/16 BT"
Placed a 4" squared and scribed cedar post adjacent.	Bearings are magnetic. 4" cedar post adjacent.

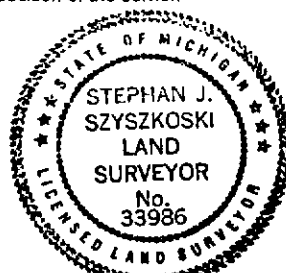

Signed by

Stephan J. Szyszkoski

Date

8/27/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division