

64

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft

(County)

Located in:

Corner Code #

1. Public Land Survey

T ___ R ___
T ___ R ___
T ___ R ___
T ___ R ___

2. Property Controlling
in Section

S 34 T 46N R 13W 1
S 34 T 46N R 13W 9

3. Miscellaneous
Property in Sec.

S ___ T ___ R ___
S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

9 Aug 21 1997

3 Aug 13 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(3-Sec. 34) North 1/16 corner between Sections 33-34. Corner established in 1970 by Billy D. Buckler, RLS, " This corner placed midway and on line bet. Sec. Cor. 1/2 mile to north and 1/4 cor. to south. 1" pipe with 4" aluminum cap. 5" J. Pine N85E 16.3', 9" J. Pine N33W 10.9'".

(9-Sec. 34) East 1/16 corner, Section 34. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(3-Sec. 34) Recovered the 1970 monument as described, in good condition, and at record bearing and distance from the 1970 witnesses, both in good condition. The monument was found 0.26' east and 0.07' north of the position intended by Buckler. I accepted the monument as a careful and faithful determination of the position of the corner. Left the monument in place and marked two new bearing trees as described below. Corner recovered and re-witnessed by T.Stark, Newberry District Office.

(9-Sec. 34) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between Center of Section 34 1316.63' West and Quarter corner 1316.63' East. At the position for the corner, I placed a 1" I.O. x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(3) Found 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails
in the following:


7" J. Pine N89E 16.55' "N1/16"
12" J. Pine N29W 11.2' "N1/16"
10" J. Pine S66E 16.1' "N1/16 NBT"
4" J. Pine S39E 4.7' "N1/16 NBT"

Placed 6" cedar post adjacent. Bearings
are magnetic.

(9) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails
in the following:

5" Cedar S68W 15.2' "E1/16 BT"
6" Cedar N34W 4.95' "E1/16 BT"
5" Cedar N22E 9.8' "E1/16 BT"
8" Cedar S38E 10.95' "E1/16 BT"

A 6" squared spruce is adjacent.
Bearings are magnetic.

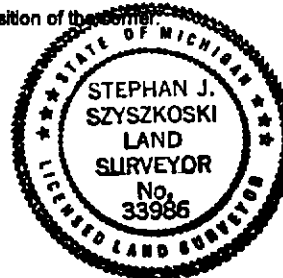

Signed by

Stephan J. Szyszkoski

Date

8/27/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division