

65

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft

(County)

Located in:

Corner Code #

1. Public Land Survey

T 46N R 13W

I11

T 46N R 13N

H11

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Aug 13 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

(I11) Corner common to Sections 26-27-34-35. Corner re-monumented from original Tamarack BT by M.Sperhake, RLS in 1963. Perpetuated with: 1"x3" galvanized iron pipe with aluminum Kimberly-Clark Corp. cap. W. Pine 6 N71W 333 links.

(H11) Quarter corner common to Sections 27-34. Corner established in 1850 by Guy M. Carleton: "39.94 Set quarter post. Spruce 4 N56W 15 links, Spruce 3 SSE 20 links". Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(I11) Recovered the 1963 monument, as described, in good condition, and at record bearing and distance from the W.Pine witness, now 8" diameter. Left the monument in place and marked 4 new accessories as described below. Corner recovered and re-witnessed by T.Stark, Newberry District Office.

(H11) Original post and accessories not recovered. Found no evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 2631.20' East and West, being proportionate to the original record. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(I11) Found 1" pipe with Kimberly-Clark Corp. cap. Blazed, scribed, and set measuring nails in the following:

4" Spruce S51W 3.8'
3" Tamarack N63W 18.75'
4" Spruce N32W 18.0'
2" Tamarack S26E 19.6'


Bearings are magnetic.

(H11) Set 1" pipe with 4" MDNR cap.

Blazed, scribed, and set measuring nails in the following:

5" Spruce N77E 23.0' "1/4S NBT"
4" Spruce S51E 15.6' "1/4S NBT"
4" Spruce S21W 12.0' "1/4S NBT"
3" Spruce S76W 15.25' "1/4S NBT"

A squared 4" spruce bears North, 1.5' distant. Bearings are magnetic.

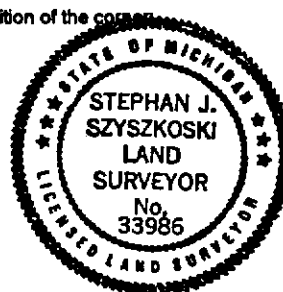

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 8/27/98

For the Michigan Department of Natural Resources - Forest Management Division