

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in  
Schoolcraft  
 (County)

Located In: \_\_\_\_\_ Corner Code ## \_\_\_\_\_

- |                                    |   |            |   |            |           |
|------------------------------------|---|------------|---|------------|-----------|
| 1. Public Land Survey              | T | <u>47N</u> | R | <u>13W</u> | <u>62</u> |
|                                    | T | _____      | R | _____      | _____     |
|                                    | T | _____      | R | _____      | _____     |
|                                    | T | _____      | R | _____      | _____     |
| 2. Property Controlling in Section | S | _____      | T | _____      | R         |
|                                    | S | _____      | T | _____      | R         |
| 3. Miscellaneous Property in Sec.  | S | _____      | T | _____      | R         |
|                                    | S | _____      | T | _____      | R         |

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Jul 15 1997

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_\_, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:


(G2) Quarter corner common to Sections 3-4. Reestablished in 1970 by Billy D. Buckler RLS by single proportionate measurement between two Section corners. 1" pipe with 4" aluminum cap. 13" B. Cherry S56W 33.5'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G2) Recovered the 1970 monument as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped, buried in the road shoulder, approximately 10.5' south of the road centerline, at record bearing and distance from the 1970 B.Cherry witness. Left the monument in place, made a new BH blaze on the B.Cherry, and marked three new witness trees as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G2) Found 1" pipe with 4" alum. cap. Blazed, scribed, and set measuring nails in the following:  
 24" B. Cherry S59W 33.6' (1970 wit)  
 3" Spruce S29E 22.9' "1/4S HBT"  
 28" W.Pine S38W 9.5' do  
 24" Cherry N88W 40.1' do  
 Bearings are magnetic. Distances are to nail w/ tag.

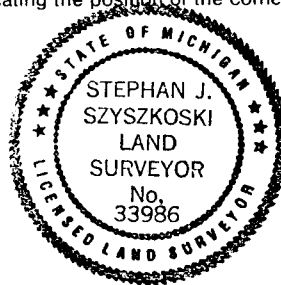

Signed by Stephan J. Szyszkoski Date 4/18/00  
 Surveyor's Michigan License No. 33986