## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970


| For corners in<br>Schoolcraft  | Located in:                | Corner Code #            | } |
|--|----------------------------|--------------------------|---|
| (County)   | Loosio III.                | <b>Como</b> : <b>Coo</b> | 1 |
| 1. Public Land Survey  | T 47H R<br>T 47H R<br>T R  | 14N C7<br>14N C8         |   |
| Property Controlling     In Section     Miscellaneous     Property in Sec. | TR<br>S TR<br>S TR<br>S TR |                          |   |

Register of Deeds Stamp & File Number

| 4. Lot No         | , Recorded Plat |  |
|-------------------|-----------------|--|
| 5. Private Claims | ·               |  |

May 12 1997

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

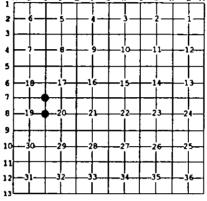

A Description of original monument and accessories and/or subsequent restoration:
(C7) Corner common to Sections 17-18-19-20. Corner perpetuated in the original position by f.J. 8ray in 1956 from the two original M. Pine bearing trees. Remonumented with a 1" pipe with 4" brass cap. New bearing trees: 8" Red Pine NBIN 35 links, 20" White Pine stub 5088 83 links. Found no subsequent record.

(CB) Quarter corner common to Sections 19-20. Corner perpetuated in the position of the original Y. Pine corner tree by Frank J. Bray in 1956. Mew monument: 1" pipe with 4" brass cap. Bray's witnesses are 7" M. Pine M40M 52 links, 15" R. Pine S04E 62 links.

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(C7) Recovered the 1956 monument, as described, a 1° ID iron pipe capped with a 4° dia. brass MI Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1956 accessories. The R. Pine is now 30° dia, and in good condition. The N. Pine stub is rotting. Left the monument in place and marked new bearing trees as described below. Corner recovered and rewitnessed by T.Stark, and D.Lampela, Newberry District Office. No surface evidence of the original BTs exists. The corner lies in a road intersection with roads S and N.

(C8) Recovered the 1956 monument as described, a 1° ID iron pipe capped with a 4° dia. brass MI Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1956 witnesses. The 7° M. Pine is now 14° and in good condition. the R. Pine is standing but now dead. Left the monument in place and marked new mitnesses as described below. Corner recovered and rewitnessed by T.Stark and D.Lampela, Memberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner (C7) Found 1 pipe with 4 brass cap. (C8) Found 1 pipe with 4 brass cap.

Blazed, scribed, and set measuring nails Blazed, scribed, and set measuring nails in the following: in the following: 30° R. Pine #84W 23.1' "S18 NBT" 14" W. Pine N37N 34.65' "1/4S" 8" R. Pine N35W 53.75' "S18 NBT" 16" R. Pine NI6E 13.7' "1/4S NBT" 12" W. Pine S68W 61.9" "S19 WAT" 12" R. Pine SBOE 4.45' "1/4S NBT" 6" Maple \$23E 59.0' "\$20 NBT" 10" R. Pine SOBE 3.05' "1/45 NBT" Placed a 4" squared and scribed post Placed a 5" Squared and scribed post adjacent. Bearings are magnetic. adjacent. Bearings are magnetic.

STEPHAN J. SZYSZKOSKI LAND SURVEYOR No. 33986

Signed by Stephen Songahook.
Surveyor's Michigan License No. 33986

Date 3/25/98

For the Michigan Department of Matural Resources - Forest Management Division