## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY & REMONUMENTATION

NOV 0 3 1998

SECTION

Corner Code # For corners in Located in: Shiawassee (County) K-10\_ R\_ 2E 1. Public Land Survey 2. Property Controlling In Section 3. Miscellaneous S Property in Sec. Recorded Plat 4. Lot No.

Register of Deeds Stamp & File Number

I, Mark L. VanRaemdonck, in a field survey on June 22, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
  - 1. Original, William Brookfield, D.S., December 1823 Monument: Wood post Monument: Wood post Accessories: Beech 12 S41/2°E 10 do 10 N25°E 20
  - 2. Mark L. VanRaemdonck, LCRC recorded L 2, page 129, October 18, 1978 Set PK in 14" Maple

Monument: Found RR spike Accessories: East

5. Private Claims


30.73 Set PK in 18" Oak 51.85

36.12' Set PK in pole
10.00' ← Physical centerline pavement \$30°E N85"W

3. Mark L. VenRaemdonck, Certified Survey, recorded L. 7. page 702, November 5, 1996

13.0 N end 12" conc. cutv. \$60°W PKN face util pole 36.10 N87\*W

Monument: Found RR spike centerline asphalt Accessories: West

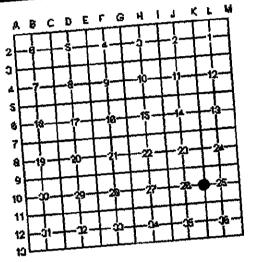

## APPROVED

County Remonumentation Peer Review Group

NCC TOUT 38



- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner: Enption of corner evidence round and/or method applied in restoring or re-establishing corner found railroad spike as referenced in No. 2 and No. 3 above. I accepted this location as the original corner position based on the best available evidence. During excavation for Harrison Marker, I found stones and a ½ " pipe. I removed the stones and drove the pipe lower. The pipe is on the SE edge of the bottom of the Harrison Marker. Found no conflicting evidence.
- C. Description of monument for corner and accessories to perpetuate locating the position of the corner:

  1 replaced the rerod and cap with a standard Shlawassee County Harrison Marker Monument, stamped "Remon P.S. 24622"

  and witnessed by the following accessories: and witnessed by the following accessories:

PK in N face util, pola Top cen. S and 12" CMP culv. Top cen. S and 12" conc. culv. 36.30 N85\*W 36.83 N60°W Top of wood post (10") in asphalt centerline of asphalt surface 50.55 \$30°W 19.10

Surveyor's Michigan License No.

3007697 Page: 1 of 1 10/27/1998 03:22P

Lb-1 Pg-250

Date <u>SEPT. 18, 1998</u>

form approved by Michigan State Board of Land Surveyors

JAN 18, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983