LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

SURVEY & REMONUMENTATION

Lb-1 Pg-251

For corners in NOV 0 3 1998 Located in: Corner Code # Shlawassee (County) SECTION R_ 1. Public Land Survey L-9 AN 2E 2. Property Controlling Register of Deeds Stamp In Section & File Number 3. Miscellaneous S R 3007698 Property in Sec. R Page: 1 of 1 4. Lot No. , Recorded Plat 10/27/1998 03:22P 5. Private Claims

I, Mark L. VanRaemdonck, in a field survey on June 22, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior. Bureau of Land Management or by a decree of a Court of Law and/or that the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, reestablished, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Description of original monument and accessories and/or subsequent restoration:
Original, William Brookfield, D.S., December 1823
Monument: Wood post
Accessories: W Oak 40 East 38LKS
B Oak 24 N5°W 30

- Andre Huggins, County Surveyor, County Surveyors Book B, page 61, August 1855 No monument or accessories are given.
- Ezra Mason, County Surveyor, County Surveyors Book A, page 244-245, August 5 & 6, 1872.
 No monument or accessories are given.
- 4. O.M. Elliot, County Surveyor, Book CR 174, page 55, no date.
 Monument: Not given.
 Accessories: S30°W 23.53' 18" Maple N20°W 23.11' 15" Maple

18" Maple 15" Maple

N50°E

20" Hickory corner fence post

5. John Quine, County Surveyor, Book G, 10/23/66 Monument: 11/2" iron Accesso

Accessories: Same as No. 4 above

6. Mark L. VanRaemdonck, Certified Survey, recorded Liber 3, page 37, June 9, 1978
Monument: Found 1½" iron bar
Accessories: South 32.40 3/4" pipe in conc. N10"W 23.53' F

32.40 23.35

3/4" pipe in conc. PK in 18" Maple

N10°W N30°E

23.53° 29.55°

PK in 14" Maple PK in 24" Maple

- Mark L... VanRaemdonck, Certified Survey, recorded Liber 3, page 92, September 18, 1978 Monument and accessories same as No. 6 above.
- Mark L. VanRaemdonck, LCRC, recorded Liber, page 129, October 18, 1978 Monument and accessories same as No. 6 above.
- Mark I.. VanRaemdonck, Certified Survey, recorded Liber 3, page 214. Monument and accessories same as No. 6 above.
- Mark L. VanRaemdonck, Certified Survey, recorded Liber 3, page 281.
 Monument and accessories same as No. 6 above.
- Mark L. VanRaemdonck, Certified Survey, recorded Liber 3, page 272, November 29, 1979 Monument and accessories same as No. 6 above.
- Mark L. VanRaemdonck, Certiffed Survey, recorded Liber 3, page 592, February 2, 1982.
 Monument and accessories same as No. 6 above.
- 13. Mark L. VanRaemdonck, Certified Survey, recorded Liber 4, page 491, September 25, 1986
 Monument: Found 11½" steel pin
 Accessories: N30"E 29.00' PK S face 18" Maple S05"W 22.50' F
 S02"E 49.36' PK E face T/P S60"E 55.95' F

14. Mark L. VanRaemdonck, Certified Survey, recorded Liber 4, page 637, September 23, 1987 Monument and accessories same as No. 13 above.


- Norm Cakiweli, LCRC, recorded Liber 2, page 658, August 3, 1989 Monument and accessories same as No. 6 above.
- Norm Caldwell, LCRC, recorded Liber 5, page 302, August 3, 1989 Monument and accessories same as No. 6 above.
- Mark L. VanRaemdonck, Certified Survey, recorded Liber 6, page 248, August 13, 1992 Monument and accessories same as No. 13 above.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner: Found 1 ½ steel pin, bent to South, as referenced in No. 4, No. 6 and No.13 above. Found large stones around pin. Found no conflicting evidence. I accepted this location as the original corner position based on the best available.
- C. Description of monument for corner and accessories to perpetuate locating the position of the corner: I replaced the 1 1/2" steel pin described above with a Standard Shiawassee County Harrison Marker Monument, stamped "Remon P.S. 24622" an witnessed by the following accessories:

 802°E 49.06' N&T 24622 W face util, pole South 31.98' Old 3/4" pipe in conc.

 820°W 27.98' N&T 24622 W face 24" Maple S70°W 56.70' N&T 24622 N face 30" Maple N40°E 29.87' N&T 24622 SE face 30" Hickory North 24.50' anchor post (down)

Signed by Surveyor's Michigan License No.

Date SEPT. 21 1998
FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SUR

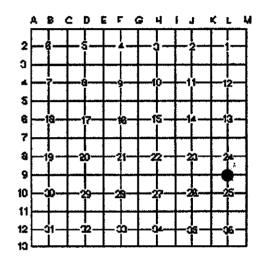

APPROVED

County Remonumentation Peer Review Group

NCC 70CT 98

