

1996 REMONUMENTATION PROGRAM
 LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Dayton Township

<u>Tuscola</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T11N R 10E T R T11N R 11E T R	M-4 A-4
2. Property Controlling in Section	S T R S T R	
3. Miscellaneous Property in Sec.	S T R S T R	

RECEIVED FOR RECORD
 LIBER NO. _____ PAGE NO. 88
 FILE NO. Dayton
 96 DEC 10 PM 4:50
 TUSCOLA COUNTY REGISTER OF DEEDS
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Kenneth D. Dunton in a field survey on May 19, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:
 G.L.O. 1834 Date of Survey unknown.
 Harvey Parke, D.S. Edward Teskey, County Surveyor, May, 1973
 Set Quarter Sec. Post 1895-1898 L.C.R.C. form filed by
 Beech 5 S47W23 Section 7, T11N-R11E David T. Rowe, Land Sur-
 Hemlock 8 N2W17 Cedar stake set by equal dist. veyor #11192, Page 22,
 Dayton Twp.
 Fnd. stone, set re-rod & cap over stone

Note: Section A continued on back of form.
 B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found stone described on L.C.R.C. Page 22, Dayton Township and from 1973 and 1980 surveys. Re-rod & cap over stone missing. Accepted stone as the best evidence of the original corner.

West 45.35' RLS 11192 tag in P.P. N15°E 84.45' RLS 11192 tag in T.P. N45°W 93.85' RLS 11192 tag in 15" Apple.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 Removed stone & placed standard monument stamped corner M-4, T11N-R10E.
 S88°W 47.77' set T.C. tag & nail in N. face new P. pole.
 West 33.00' fnd. 1/2" rod & cap #11192.
 N22°E 84.40' fnd. nail & tag #11192 in SW face T. Pole.
 N86°E 25.80' center of 3" pipe in concrete.
 S36°E 55.51' fnd. 1/2" rod & cap #23510.

Note: This corner is common with A-4, T11N-R11E.

Signed by [Signature]
 Surveyor's Michigan License No. 23503

Date 12-4-96

APPROVED
 12-4-96
 [Signature]

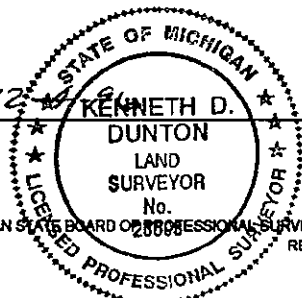

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983
 REVISED OCT., 1995

MAY 20 1997
 COMPTROLLER

June 27, 1973

Survey by David T. Rowe, Land Surveyor #11192, Liber 436-Pages 267 & 268.
Re-rod.

West 45.35' RLS 11192 tag in P.P.

N15°E 84.45' RLS 11192 tag in 15" Apple.

N45°W 93.85' RLS 11192 tag in 15" Apple.

Aug. 18, 1980

Survey by Earl E. Gravlin, Land Surveyor #23510, Liber 508-Pages 1092 & 1093.

West 45.35' nail P.P.

N15°E 84.45' nail 15" Apple.

N45°W 93.85' nail 15" Apple.

July 22, 1993

Unrecorded survey by Earl E. Gravlin, Land Surveyor #23510, Job #93641.
No mention of object found or set or accessories.

