

MAR 31 1994

COMMISSION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED

1993 DEC 29 AM 9:43

*Linda Doughmiller*  
WEXFORD COUNTY, MI  
REGISTER OF DEEDS

For corners in

<u>Wexford</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>23N</u> R <u>9W</u>	<u>M-9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						

I, Richard Wilcox in a field survey on November 11, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- M-9) 1838 GLO Section corner post by John Brink, Deputy Surveyor  
Beech 10" S 29° W 35, Beech 20" N 45° W 23
- M-9) 1973 Roser survey in Section 25: Liber 1, page 284, Found and accepted fence post, set DNR monument, Beech 10" S 29° W 35, Beech 20" N 45° W 23, 10" Hemlock S 77° E, 54, 9" Maple S 81° W 43.3, 14" Maple S 20° E 70.6, North-South random line West 8

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- M-9) Section corner common to Sections 24, 25 and 19, 30 T23N, R8W  
Found DNR monument/marker post ±2' North of East-West downed fence and on fence line to the North. This corner is accepted as a careful and faithful perpetuation of the position of the original corner.

Peer Group Reviewed and Approved

Date: 11-29-93  
*Richard D. Wilcox*  
Richard D. Wilcox, Wexford County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-9) Standard DNR monument on 1" pipe  
S 75° E - 54.78 - 10" Hemlock  
S 83° W - 43.89 - 14" Maple  
S 19° E - 70.95 - 20" Maple  
N 16° E - 55.91 - 8" Twin White Birch

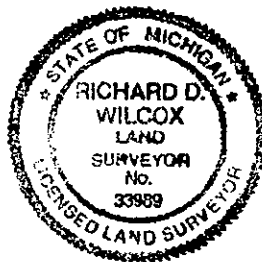

Signed by *Richard D. Wilcox* Date 11/29/93  
Surveyor's Michigan License No. 33989