

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER	
1. PUBLIC LAND SURVEY	T. 24 N. R. 9	G-1; G-2	REGISTER OF DEEDS STAMP AND FILING NUMBER
2. PROPERTY CONTROLLING IN SECTION	4 T. 24 N. R. 9	2; 7; 11	
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. E. S. R. W.		
4. LOT NO. _____, RECORDED PLAT _____			
5. PRIVATE CLAIMS _____			

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on October 8, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_ 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

**A. Description of original monument and accessories and/or subsequent restoration:**

C. (continued)

7	11
Set 1"x36" pipe & cedar post w/loc. tag	Set 1½"x36" pipe & cedar post w/loc. tag
9" B. cherry S75°E 20.6	12" J. Pine N53°E 97.59
16" Oak S16°E 37.9	10" J. Pine S06°W 105.30
8" B. cherry S38°W 75.3	10" J. Pine S44°W 132.14

**B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:**

- G-1 Found boat spike over 2" pipe as recovered by RLS J. Wilcox. This corner also recovered by M.D.S.H. in 1955.
- G-2 Restored ¼ corner on line between section corners to north and south and at prorated distance to U.S. meander.
- 2 Established corner per standard B.L.M. instructions.
- 7 Established corner at prorated distance to U.S.
- 11 Established center of SW¼ per standard B.L.M. instructions. Found possible fence post 33'± west and 30'± south.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

G-1	G-2	2
Fd. iron raised w/ ½"x6" pipe	Set std. Wexford Co. mon. & cedar post	Set 1"x15" pipe
16" Oak S08°E 76.76	15" Cedar S44°E 22.7	18" Oak S27°W 58.44
18" Oak N05°W 75.85	10" Cedar S02°W 33.2	14" W. Pine S22°E 55.65
14" Oak N50°E 65.35	9" Cedar Due N 67.0	Set ced. post w/loc. tag
ced. post w/loc. tag Due S 38.5		Due S 36.5
on ctr. fire lane north		Ctr. E-W b. top co. rd.
Ctr. E-W b. top co. rd.		Due S 3.5
Due S 5.5		


SIGNED BY Carl F. Roser DATE 3-4-75

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

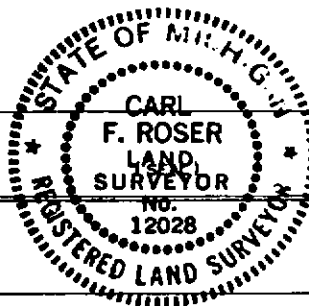

(SEAL)