

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY.....	T. 24 N. R. 12 W.	C-4; C-5; C-6
2. PROPERTY CONTROLLING IN SECTION.....	T. N. S., R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION.....	T. N. S., R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
 FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 14, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~As described in original monument and record and as subsequently corrected:~~

B. (CONTINUED)
 being very vague. In view of probable 100' position error in original Govt. survey in general area of E line of Sec. 7 & 18 and line between these sections, McClung's section line between Sec. 17 & 18 was accepted. Also, 1938 & 1965 aerial photos do not indicate a fence W from W $\frac{1}{4}$ Section 17. No other old survey records were found in Sec. 7-8-17-18.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-4 Reestablished $\frac{1}{4}$ corner equidistant & on line between section corners to N & S.
- C-5 Accepted pipe as found or placed by RLS Frank McClung (deceased) in 1961. Also see "Restoration Procedure" item B, corner C-6, W $\frac{1}{4}$ Section 17.
- C-6 Recovered 3/4"x20" rod in E'ly edge of recently upgraded irreg. N-S graveled co. road, in line w/fence to W & on S'ly R-O-W of new E-W pipe line opening. Corner as fd. would fit a position as shown (no corner set) on survey sketch by F. McClung, RLS, for H.J.Wells, MD, Eloise, Mich., dated 1961. McClung notes would seem to indicate he fd. the SW Sec. 17 in road intersection & accepted an irregular junction of trail road E & S for NW Sec. 17, possibly having recovered an iron at N 1/16 on W line Sec. 17; McClung's notes (see above)

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-4	C-5	C-6
Set Wexford Co. Mon. & cedar post w/loc. tag	Fd. 1 $\frac{1}{4}$ "x36" Conc. capped pipe & added cedar post w/loc. tag & replaced with Wex.Co.Mon.	Set std. Wexford Co. Mon.
10" B.Cherry N67 $^{\circ}$ E 34.6	10" Maple N39 $^{\circ}$ E 75.0	12" B.Cherry N12 $^{\circ}$ E 81.3
9" Maple N44 $^{\circ}$ W 41.7	12" B.Cherry S86 $^{\circ}$ E 62.9	8" B.Cherry N46 $^{\circ}$ E 123.6
8" Twn.B.Cherry S18 $^{\circ}$ W 62.0	6" W. Pine S28 $^{\circ}$ W 58.3	7" B.Cherry S23 $^{\circ}$ E 79.7
10" B.Cherry S38 $^{\circ}$ E 80.5	10" Maple N72 $^{\circ}$ W 34.0	Irreg. trail rd. from E, Due N, 125' \pm
N-S Random Due W 7'		Irreg. Fn. Remains to E, Due N, 135' \pm
		Set cedar post w/loc. tag, Due E, 33'


SIGNED BY Carl F. Roser 4-28-77 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

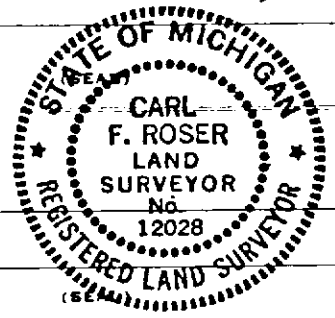

SURVEYOR'S MICHIGAN REGISTRATION NO. _____
 WEXFORD TOWNSHIP
 WEXFORD COUNTY