

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich; P.A. 1970

For corner in Washtenaw Located in: _____ Corner Code # _____
(County)

1. Public Land Survey T 2S R 7E E-9
T _____ R _____
T _____ R _____
T _____ R _____

2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
Property in Sec S _____ T _____ R _____

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____



Register of Deeds Stamp & File Number

I, Charles C. Wilson, in a field survey on September, 19 99, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instruction of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	8		5		4		3		2				
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
United States Government Survey, 1815 Instructions, Surveyed 1819, Joseph Wampler, D.S.
Bearing Trees A) Ash 27" S5deg.E 11.22
B) Sugar 4" N56deg.E 3.63

Continued on Back

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Found a 3/4" Iron Pipe at the centerline intersection of Vreeland and LeForge Roads, 0.7 below gravel surface.
Verified location with six remaining previous accessories.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Installed Remonumentation Cap on existing 3/4" Iron Pipe, 0.7 below gravel road surface.
Previous Accessory 16) MBT Cable Riser Post S50deg.E 51.81
Previous Accessory 18) Utility Pole N70deg.W 177.38 Nail and RT S/S
Previous Accessory 19) Twin 8" Elm S60deg.E 86.60 Nail and RT N/S
Previous Accessory 20) Wood Post S45deg.E 52.10 Nail and RT W/S
Previous Accessory 21) Wood Post N05deg.E 39.09 Nail and RT W/S
Previous Accessory 22) North end of 36" CMP N50deg.E 38.84
New Accessory MBT Cable Riser Post N'y 42.85
New Accessory South end of 36" CMP S60deg.E 38.77
I find no evidence to conflict with the acceptance of this point as being the best available evidence for the position of this corner.
This point was ratified by the Washtenaw County Peer Committee on November 15, 1999.

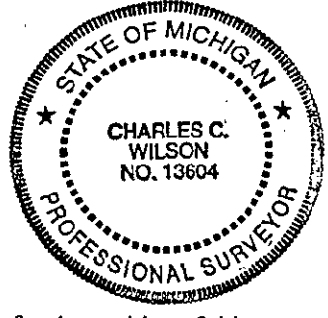

Signed by Charles C. Wilson
Surveyors Michigan's License No. 13604

Date November 15, 1999


APPROVED
DATE 11/15/99
CO. REP. KX

REIN

MAY 2000

SECTION

- Copy -



5094765
Page: 2 of 2
02/07/2000 02:55P
Peggy M. Haines - Washtenaw Co. CORREM L-3 P-44

Paragraph A. Continued

1870+- Pettibone's Witness Book on file at Atwell-Hicks, Inc.

- 1) 4" Tree S9deg.W 15.84
- 2) 6" Hickory S59deg.E 117.48
- 3) 6" Poplar S11deg.W 115.50
- 4) 3" B. Ash N52deg.E or N3deg.E 49.50

Oct. Washtenaw Eng. Co., Inc.

1971 Norman N. Fahrner, PLS #17620

Survey Drawing

Found 1/2" Iron Bar

- 5) 2" Hickory S62deg.E 34.85
- 6) 30" W. Oak N7deg.E 42.30
- 7) 8" x 8" Concrete Post N4deg.E 25.00
- 8) Iron Pipe S'y 33.00

Oct. Washtenaw Eng. Co., Inc.

1971 Norman N. Fahrner, PLS #17620

LCRC, Liber 1, Page 285

Found 1-1/2" Iron Pipe

- 9) 18" Ash N45deg.W 40.8
- 10) 24" Maple S18deg.W 30.3
- 11) 12" Ash S63deg.E 55.3

June Washtenaw Eng. Co., Inc.

1973 Norman N. Fahrner, PLS #17620

Survey Drawing

See Witnesses 5), 6), 7) & 8)

April Robert Campbell, PS #13028

1977 LCRC, Liber 4, Page 198

Found Boat Spike

Re-set with 3/4" x 36" Iron Pipe

- 12) Corner Fence Post N5deg.E 30.40
- 13) NW Corner, West end, North Headwall N63deg.E 32.66
- 14) NE Corner, East end, South Headwall S63deg.E 44.02
- 15) 1-1/4" Iron Pipe E'y 37.51
- 16) MBT Cable Riser Post S50deg.E 52.09
- 17) 1/2" Iron Pipe (Bent) S50deg.W 46.88
- 18) Utility Pole N70deg.W 177.33

Feb. WCRC Grid Book

1994 Found Pinched Top Iron Pipe

- 19) Twin 8" Elm S60deg.E 85.69
- 20) Wood Post S45deg.E 52.09
- 21) Wood Post N'y 38.96
- 22) Pinch Mark in a CMP N50deg.E 38.71

