

MAY - 1 1995

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

COMMISSION

Washtenaw (County)

Located In:

Corner Code #

1. Public Land Survey	T 4S R 3E	K-11
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

- COPY -
PERGY M. HAINES
COUNTY CLERK/REGISTER

DEC 1 11 38 AM '94

RECORDED
WASHTENAW COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Patrick L. Hastings in a field survey on October 7, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1816	Subdivision of Township. Set post at 80 chains in edge of swamp
(1) B. Ash	5" N 5° W 34 lks
(2) W. Oak	30" S 84° E 2.11 ch
1824	Township GLO Plat by John M. Mack
1930s	W.C.R.C. Grid Book, handwritten G.L.O. witnesses, no others
No Date	Atwell & Hicks drawing, compilation of information. Repeat G.L.O. witnesses, no others

CONTINUED ON BACK


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1994	Found 3/4" iron pipe and raised with boat spike 12" below surface. Along southerly edge of E-W road and CL of road to south and on an occupational fence line to north.
(6)	N 40° W 38.92' 10" Walnut; Found nail and flasher in face
(10)	S 64° E 73.2' 10" Ash clump, PK gone

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

After a careful study of the record documentation and field observations, made under my direct supervision, I find this corner as remonumented to be the best available evidence of the position of the original corner.

CONTINUED ON BACK

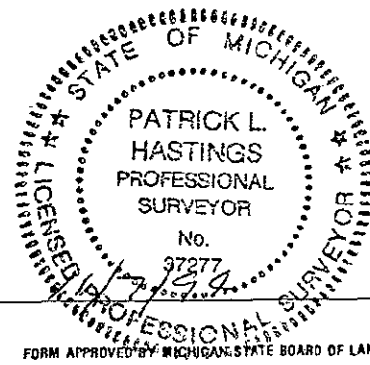

Signed by Patrick L. Hastings Date _____
Surveyor's Michigan License No. 37277

- copy -

SECTION 'A' CONTINUED

1958 Survey by Atwell-Hicks, Inc.
 (3) S 30° E 41.3' 4" Iron Fence Post
 (4) N 20° W 25.3' 8" Elm
 (5) S 44° W 34.1' Utility Pole

1977 Survey by Walter E. Frazier and Associates
 (6) N 45° W 39.06' 10" Walnut
 (7) S 20° W 47.85' Telephone Pole

1977 L.C.R.C. by Norm Fahrner, found pipe and boat spike
 (6) N 40° W 39.1' 8" Walnut and flasher
 (8) N 10° E 33.4' 2" Steel Post
 (9) S 35° E 36.7' Road Sign

1978 L.C.R.C. by Kenneth L. Svydam, found iron pipe and boat spike
 (6) N 45° W 39.06' 10" Walnut Nail and Shinner
 (7) S 20° W 47.85' Telephone Pole Nail and Shinner

1991 Survey by Gerald Myers, found 3/4" Iron Pipe and boat spike
 (3) S 30° E 39.88' Corner wood fence post, PK set in top
 (6) N 40° W 38.92' 10" Walnut, found nail & flasher
 (10) S 64° E 73.15' 10" Ash, clump of 4, set PK
 (11) N 66° E 64.05' 14" Elm, set PK

SECTION 'C' CONTINUED

Set 1" x 24" iron pipe capped with standard remon. cap stamped #37277.
 (3) S 30° E 39.88' 4" Corner wood fence post, top RT & PK
 (6) N 40° W 39.27' 10" Walnut, RT & PK S.W. Face
 (10) S 64° E 73.43' 10" Ash Clump, RT & PK
 (12) S 60° W 70.03' 12" Elm, RT & PK
 (13) N 60° E 84.02' 14" Elm, RT & PK

APPROVED

DATE 11/7/74CO. REP. KA