LAND CORNER RECORDATION CERTIFICATE

Filling Requirement of Act 74, Mich. P.A. 1970 &

SURVEY & REMONUMENTATION

JAN 1 8 2004

SECTION

Liber 5 Page 239

RECORDED
LAKE COUNTY, MI
21 OCT 2003 1:02:05 PM
SHELLY MYERS
REGISTER OF DEEDS

Register

For corners in Lake (County)

	Located in:	Corner Code#
1. Public Land Survey	T18N R14W	D-9
	T__N R__W	
	T__N R__W	
	T__N R__W	
2. Property Controlling	S___ T__N R__W	
in Section	S___ T__N R__W	
3. Miscellaneous	S___ T__N R__W	
Property in Sec.	S___ T__N R__W	

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

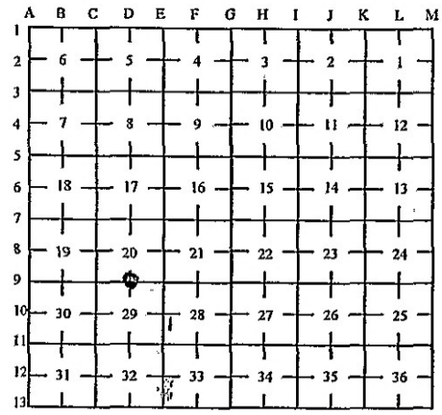

I, Robert L. Wetherell, in a field survey on June 14, 2003, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

¼ Corner common to Sections 20 & 29

A. Description of original monument and accessories and/or subsequent restoration:

1838 S. Sibley, G.L.O.
#1. 8" Beech N14°E, 22 Lks.
#2. 6" White Oak S7°W, 11 Lks.

1978 C. Cole, L.S. 17615
Distance East = 2626.88'

Undated G. Johnson, Co. Surveyor
#3. 12" Black Oak N59°E 51.5'
#4. 8" White Oak S31°E 51'

1964 R. Griffin, L.S. 13584
L.C.R.C., L.01, Pg. 101
Found 7/8" rod and both Johnson's witnesses, set concrete mon.
#6. 7" White Oak N68°E 102.50'
#5. Post East 1.8'
#4. 19" White Oak S31°E 51.56'
#7. 7" Black Oak S57°W 49.83'
#8. 2" Black Oak N54°W 30.90'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Griffin's 5" concrete monument 250' (M/L) South of E-W railroad tracks. It fit the recovered accessories well.

Condition of Accessories: #1, Gone, #2, Gone #3, Found stump, #4, Found in good condition, #5, Found in good condition, #6, Found in good condition, #7, Found in good condition, #8, Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" concrete monument as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

9" White Oak	N70°E	102.50'	(dock spike in SE side) #6
7" White Oak	N65°W	69.40'	(60 d. spike in N. side)
26" White Oak	S25°E	51.23'	(60 d. spike in NE side)#4
14" Black Oak	S61°W	49.80'	(60 d. spike in N. Side) #7

STATE OF MICHIGAN
ROBERT L. WETHERELL
PROFESSIONAL SURVEYOR
No. 24624
LICENSED PROFESSIONAL SURVEYOR

Signed by Robert L Wetherell Date OCT. 14 2003
Surveyor's Michigan License No. 24624

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345
CHAIRMAN RLW DATE: 10-09-03

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 21, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING JANUARY, 1999