SURVEY &
REMONUMENTATION

JUL 2 3 1999

SECTION

APPROVED LAND CORNER
P.A. 345 OF 1990
Houghton County
April 30, 1999
Robert W. Crespo

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74
Mich. P.A. 1970

MARY SCHOOS 05/05/99 2
HOUGHTON COUNTY, REGISTER 15:07
LC 3/ 595 PAU Fee: 9.00
Page 1 of 1

For corners in

Houghton County (County) Located In: Corner Code #

1. Public Land Survey Section 32 T 55N R 32W E-13 (SE Corner Section 32)
   T____ R____
   Section 5 T 54N R 32W E-1 (NE Corner Section 5)
   T____ R____
2. Property Controlling S____ T____ R____ _____
   in Section S____ T____ R____ _____
3. Miscellaneous S____ T____ R____ _____
   Property in Sec. S____ T____ R____ _____

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

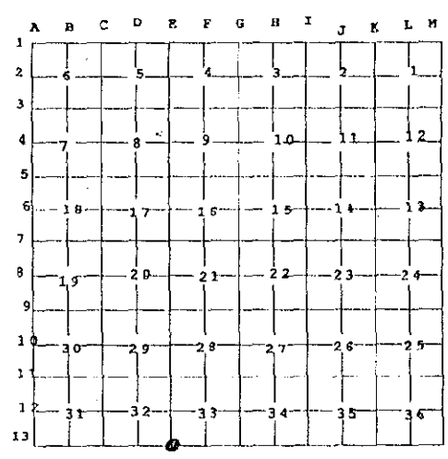

I, Michael T. Drewyor, in a field survey on December 17, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: **Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

SE ¼-Corner, Section 32: At 80.00 chains (meas. from W) set section post corner.

Cedar 10, N 43° W, 62
Hemlock 10, N 57° E, 32

No evidence of original monument or accessories found. This line was originally surveyed by Deputy Surveyor William Ives between July 13, 1845 & July 24, 1845.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1 ¾" OD (1 ¼" ID) iron pipe 13" above grade. Corner was identified to me by William P. Young (property owner) as the SE corner of Section 32.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

All witness points in trees are PK nails and washers.

SE Corner of Section – Found 1 ¼" ID iron pipe (description above).

Witnesses:

N 82° E, 35.25 ft., 9" Aspen
S 67° E, 51.25 ft., 15" Maple
S 51° W, 20.12 ft., 10" Maple
N 42° W, 5.84 ft., 15" Maple

Signed by Michael T. Drewyor Date April 13, 1999
Surveyor's Michigan License No. 24245

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

y: Hitch, Inc., P.C., Houghton, MI
Job #97012