REC'D FEB 10 2006

SURVEY & REMONUMENTATION

FEB 28 2006

2005 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Newaygo (County)

Located in:

Corner Code #

VOL. 5 SECTION 83

1. Public Land Survey — T14 N R11 W — K-1
   T N R W
   T N R W
   T N R W
2. Property Controlling in Section — S___ T N R W
   S___ T N R W
3. Miscellaneous Property in Sec. — S___ T N R W
   S___ T N R W

LINDA M. LANDHEER
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED & RECORDED
02/10/2006 12:14:42 PM

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

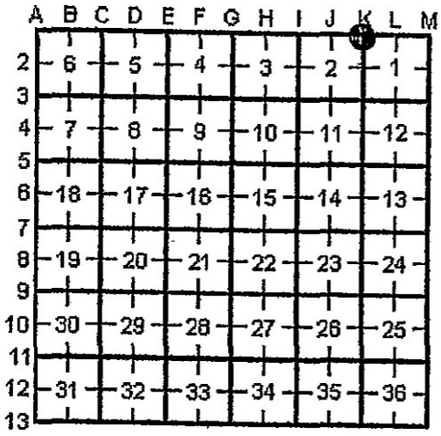

I, Norman L. Ochs, in a field survey on December 14, 2005, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

Section corner common to Secitons 1 and 2, Goodwell Township.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO – James H. Mullett
3rd quarter 1837
Intersected North Boundary 8 links East of Post
Set post corner of Sections 1 and 2
#1 12" White Oak S35°W 20 links (13.20')

William M. Jacques, County Surveyor
Petition survey of Section 2 T14N-R11W Goodwell Twp.
Book B, Pages 38 and 39, April 24, 1909
Stake with broken glass around

OVER

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

I searched for and dug with a backhoe in a root tangled bog, found no evidence of the corner at Lyle Shepherd's 1917 position or William Jacques 1909 stake and glass. Therefore I prorated a position for this corner re-tracing Lyle S. Shepherd's July 27, 1917 survey. The centerline of the North and South two-track is 27' ± West of the corner. No apparent occupation to the East. Meandering fence to the West is 15' ± South of the corner. The corner is on West edge of bog and it appears the position has been disturbed since 1917. The condition of the witnesses are as follows: #1 is gone, #2 thru #9 are not for position monumented. I did find a ½" re-rod with cap #30104 (Bill Tingley) 11.52' South and 2.42' East. And a ½" re-rod with cap #14102 (Jerry Wilcox) 11.72' South and 8.68' West. I did not honor Jerry Wilcox or Bill Tingley's position because I recovered Lyle Shepherds North quarter and West quarter corner of Section 1, which were not found or used by Bill or Jerry to compute their position for this corner. I discussed this corner problem with Bill Tingley and Jerry Wilcox and they felt our position was a better location for this corner.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I set a 4" diameter Harrison cast iron monument 30" long marked "County Surveyor #22439" pro-rated to L.S. Shepherds (#503) survey of July 27, 1917, and recorded in Book B, pages 79-79. I set monument to project 8" ± above grade and surrounded with stones, as a substantial marker for the Section corner and is accepted as a careful and faithful reestablishment of the position of the original Section corner. I removed Bill Tingley's and Jerry Wilcox's ½" Rod and cap.

16" Maple N7°W 58.94' — Set 40d spike with tag in West side
18" Maple West 38.52' — Set 40d spike with tag in South side
6" Maple S51°W 63.61' — Set 40d spike with tag in SE side
10" Black Oak S4°W 48.68' — Set 40d spike with tag in East side
4" Harrison cast iron monument Section corner common to Sections 35 and 36, T15N, R11W West 5.28'

Signed by Norman L. Ochs
Norman L. Ochs

Date January 12, 2006

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1983

Approved by Peer Review Group on December 19, 2005
Norman L. Ochs, County Representative.
N. L. O.

NORMAN L. OCHS LAND SURVEYOR No. 22439 REGISTERED LAND SURVEYOR