REC'D FEB 10 2006

SURVEY & REMONUMENTATION

FEB 28 2006

SECTION 84

VOL. 5

2005 Newaygo County Remonumentation Project

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Newaygo (County)

Located in:

Corner Code #

1. Public Land Survey — T14 N R11 W — K-2
2. Property Controlling in Section
3. Miscellaneous Property in Sec.

	T	N	R	W
	T	N	R	W
	T	N	R	W
S___	T	N	R	W
S___	T	N	R	W
S___	T	N	R	W
S___	T	N	R	W

OFFICIAL SEAL OF NEWAYGO COUNTY REGISTER OF DEEDS

LINDA M. LANDHEER
NEWAYGO COUNTY REGISTER OF DEEDS
RECEIVED & RECORDED
02/10/2006 12:14:42 PM

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

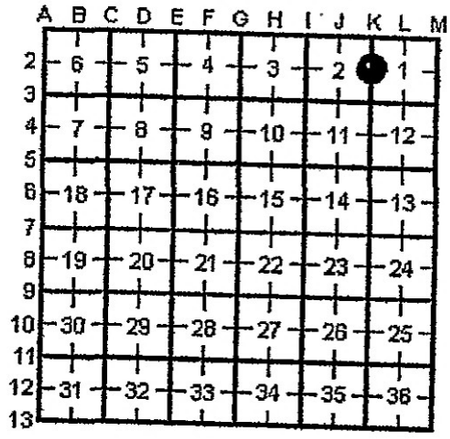

I, Norman L. Ochs, in a field survey on December 14, 2005, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Note: Not more than 2 corners, all in the same town and range, may be Recorded on this certificate.

Quarter corner common to Sections 1 and 2, Goodwell Township.

A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:

GLO – J.H. Mullett
4th quarter 1837
set quarter section post
#1 8" Beech S50°W 36 links (23.76')
#2 8" Beech N32°W 18 links (11.88')

William M. Jacques, County Surveyor
Book B, Pages 38 and 39, April 24, 1909
Stake with broken glass around

OVER

B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:

I searched but found no evidence at corner. I did find a 2" iron shaft surrounded by stones, and accepted as the South 1/16 corner 1326.92 North of Section corner. I doubled this distance to establish a position for this quarter corner. The North and South fence is 2' ± West of the corner. No apparent East or West occupation. The South edge of Marsh is 8' ± North of the corner. The condition of the witnesses are as follows: #1 thru #3 are gone, #4 thru #7 not for this position. I did find a ½" x 18" re-rod with plastic cap #30104 (Bill Tingley) 7.23'North and 5.56' East, removed it. I also found a ½" x 18" re-rod with plastic cap #14102 (Jerry Wilcox) 6.56' South and 20.9' West, removed it. I did not honor Jerry Wilcox or Bill Tingley's position because by the doubled sixteenth corner distance, I fit Lyle Shepherds distance within .64'. I discussed this corner position with Bill Tingley and Jerry Wilcox, who agreed on our location.

C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:

I set a 4" diameter Harrison cast iron monument 20" long marked "County Surveyor #22439" by double distance from K-3 thru a found South sixteenth corner, as a substantial marker for the quarter corner and is accepted as a careful and faithful reestablishment of the position of the original quarter corner. I removed Bill Tingley's and Jerry Wilcox's ½" Rod and cap.

8"-10"-16" Tri-Beech S47°W 19.75'
10" Maple N54°W 21.38'
Twin Black Oak N3°E 62.86'
8"-8" Twin Maple S83°E 8.58'

Set 40d spike with tag in SE side
Set 40d spike with tag in South side
Set 40d spike with tag in East side
Set 40d spike with tag in South side

Signed by Norman L. Ochs
Norman L. Ochs

Date January 12, 2006

Surveyor's Michigan License No. 22439

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971
Revised May 14, 1975
Revised Jan., 1963

Approved by Peer Review Group on December 19, 2005
Norman L. Ochs, County Representative.
N.L.O.

NORMAN L. OCHS LAND SURVEYOR No. 22439 REGISTERED LAND SURVEYOR STATE OF MICHIGAN