SURVEY &
REMONUMENTATION

JAN 1 6 2004

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filling Requirement of Act 74, Mich., P.A. 1970

For corners in Lake (County)

	Located in:	Corner Code#
1. Public Land Survey	T18N R14W	E-9
	T__N R__W	
	T__N R__W	
	T__N R__W	
2. Property Controlling	S___ T__N R__W	
in Section	S___ T__N R__W	
3. Miscellaneous	S___ T__N R__W	
Property in Sec.	S___ T__N R__W	

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Register of D

RECORDED
LAKE COUNTY, MI
21 OCT 2003 1:02:09 PM
SHELLY MYERS
REGISTER OF DEEDS

Liber 5 Page 241

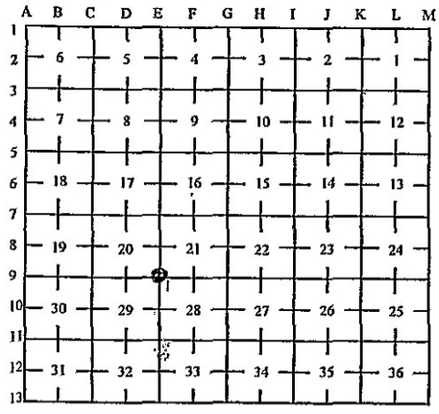

I, Robert L. Wetherell, in a field survey on June 14, 2003, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

E-9 Section corner common to Section 20 – 21 – 28 – 29

A. Description of original monument and accessories and/or subsequent restoration:

1838 S. Sibley, G.L.O.
#1. 16" Pine N46°W, 23 Lks.
#2. 12" Hemlock S31°E, 23 Lks.

1908 G. West, Co. Surveyor
#3. 6" White Oak N73°E 4.54
#4. 24" White Pine Stump S82°W 1.01
#5. Distance East = 4985.6'
#6. Distance North = 2673.66'

1952 G. Blass, L. S. 5489
Found 3" x 12" angle iron & 3/8" x 18" iron
#7. 6" Cherry S3°E 92.1'
#8. 8" Black Oak N58° - 30' E 82.55'

1964, R. Griffin, L.S. 13584
L.C.R.C., L.01, Pg. 104
Found angle iron, set 5" concrete monument
#8. 12" Black Oak N581/2°E 82.74'
#7. 12" Cherry S3°E 92.29'
#9. 10 Red Pine N66°W 8.19'
#10. Post N. 1.7'

1988 S. Barnett, L.S.16923
#5. Distance East = 4991.34'
#6. Distance North = 2671.20'

Undated Co. Survey Records
Railroad 300' South

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Griffin's 5" Concrete monument on the South side of a red pine plantation 50' (M/L) West of center of a North South two track road. It checks well with the recovered accessories.

Condition of Accessories: #1, Gone, #2, Gone, #3, Did not find, #4, Did not find, #5, Did not measure, #6, Did not measure, #7, Found in good condition, #8, Found stump, #9, Found in good condition, #10, Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" concrete monument as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

17" Cherry	S2°W	92.30'	(Dock spike in W. side)#7
18" Red Pine	N60°W	8.12'	(60 d. spike in SE side)#9
4" Black Oak	S50°W	25.41'	(60 d. spike in NW side)
16" Red Pine	N75°E	29.22'	(60 d. spike in SE side)

STATE OF MICHIGAN
ROBERT L. WETHERELL
PROFESSIONAL SURVEYOR
No. 24624
LICENSED PROFESSIONAL SURVEYOR
My 28, 2003

Signed by Robert L Wetherell Date OCT. 14, 2003
Surveyor's Michigan License No. 24624

RATIFIED BY THE LAKE CO. PEER REVIEW GROUP IN ACCORDANCE WITH P.A. 345
CHAIRMAN RHW. DATE: 10-09-03

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS
REVISED MAY 14, 1975
REVISED JAN., 1983
ADAPTED FOR WORD PROCESSING JANUARY, 1999