ALLEGAN COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

MAR 1 0 1998 COMMISSION

For corners in Allegan (County)

	Located In:	Corner Code ##
1. Public Land Survey	T 4N R 16W	J-1 (N 1/4 Sec 2)
	T ___ R ___	Laketown Twp.
	T ___ R ___	
	T ___ R ___	
2. Property Controlling	S ___ T ___ R ___	
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

1993 DEC 30 PM 2:45 FILED

REGISTER OF DEEDS ALLEGAN COUNTY, MICH

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

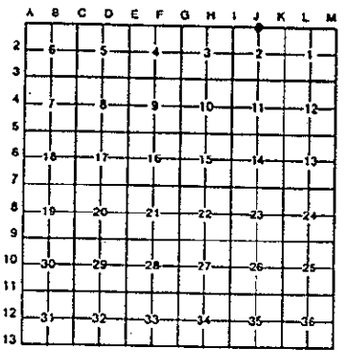

I, David R. Greer, in a field survey on November 23, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

J-1 This corner not set by the Government
Recorded in Liber 2 Page 41 Nov 21, 1972

SE Cor House	NNE	84.73'
Iron	E	96.08'
Spike in 24" Oak	ESE	59.71'

J-1
Found 3/4" Iron

10" Wild Cherry	N	20.55'
Power Pole	NE	84.68'
22" Oak	SE	59.13'

J-1 Recorded in Liber 2 Page 85, Dec 18, 1972
1" Iron in CL Road

Iron	E	88.33'

Iron	S	33.00'
SE Cor House	N20°E	84.74'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-1
Found steel bar on Township line (South line Section 35, T5N, R16W). This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.

18" Oak	SE	59.42'
Iron	E	88.36'
SE Cor House	N20°E	84.81'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-1
Replaced Steel Bar with A.C. Remonumentation Iron & Cap on S. Line, Sec. 35, T5N, R16W
AZ = Michigan State Grid Direction

SE House Corner Brick	AZ.	17°39'	84.81'
A.C. Remon tag & nail in S Side 18" Oak	AZ.	122°07'	59.42'
Sourtherly House Corner, Brick	AZ.	356°03'	81.01'
Nail & Tag #14091 in SE Side 10" Pine	AZ.	77°15'	153.15'
O.C. Remon Iron J-13, S1/4, Sec 35, T5N, R16W	AZ.	90°10'	88.36'

STATE OF MICHIGAN
DAVID R. GREER
LAND SURVEYOR
No. 16042
REGISTERED LAND SURVEYOR

Signed by David R Greer Date 11/23/93

Surveyor's Michigan License No. 16042

W:\Docs\Servi\Remon.doc

LIBER 004 PAGE 346

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 25, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983