LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
EMMET
(County)

	Located In:	Corner Code ##
1. Public Land Survey	T 38N R 5W	E-3,E-4
	T ____ R ____	
	T ____ R ____	
	T ____ R ____	
2. Property Controlling	S 9 T ____ R ____	1,2
in Section	S ____ T ____ R ____	
3. Miscellaneous	S ____ T ____ R ____	
Property in Sec.	S ____ T ____ R ____	

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

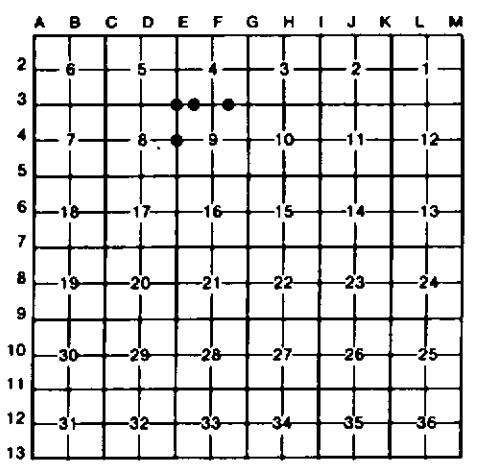

I, C.F.ROSER, in a field survey on 5-09, 19 90, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

~~A. Description of original monument and accessories and/or subsequent restoration:~~

E-3

E-4

1

2

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-3

FOUND OLD, 80'D, CEDAR POST FOR SEC CORNER COMM. TO SEC'S 4-5-8-9. BELIEVED TO BE GOOD, ORIGINAL GOVT. CORNER. COUNTY SURVEYOR, N. PALMER, MAY 1902, IN SURVEY & SEC SUB'N OF SEC 9,(CORNER "A", NW COR SEC 9) SAY'S "FOUND GOV. CORNER, SET CED POST"; (PALMER'S SURVEY OF RECORD AT EMMET CO REG OF DEEDS). SEE PHOTOGRAPH 10-22-85.

E-4

FOUND 1" STAINLESS STEEL PIPE, AT FENCE COR(FN'S E & S); FOR 1/4 COR COMM TO SEC'S 8 & 9. CORNER BELIEVED TO BE PERPETUATION OF CO SURVEYOR, N.PALMER SURVEY & SEC SUB'N OF SEC 9, MAY 1902 (OF RECORD AT EMMET CO REG OF DEEDS). PALMER'S SURVEY (COR "P") INDICATES HE SET M.O.L. BETWEEN FD GOVT COR'S TO N & S.

1

FD 3/4" PIPE FOR NE COR OF NW1/4 OF NW1/4 OF SEC 9. PIPE FALLS 0.3' WEST OF N EDGE OF OLD 80'D CEDAR POST; POST SCRIBED "1/8 P". BELIEVED TO BE PERPETUATION OF CORNER "B"; SURVEY & SECTION SUB'N OF SEC 9, BY CO SURVEYOR, N.PALMER, MAY 1902(OF RECORD AT EMMET CO. REGISTER OF DEEDS). SEE PHOTOGRAPH DATED 10-22-85.

2

ESTABLISHED NW COR OF NE1/4 OF NE1/4 OF SEC 9 PER STANDARD BLM INSTRUCTIONS. OLD E-W FENCE(WINDING ALONG TOP OF BLUFF) IS 13'±N AND 39'±W. OLD FENCE SOUTH IS 38' E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-3

FD 80 CED POST, SET DNR MON & NEW CEDAR POST.

14"MAPLE	N06°E	30.6'
8"CEDAR	S46°E	9.9'
9"CEDAR	S32°W	3.1'
9"MAPLE	N20°W	32.1'

E-4

FD 1" PIPE; ADDED DNR MON.

24"W.PINE	N60°W	37.1'
9"HEMLOCK	N25°W	4.4'
12"HEMLOCK	N20°E	4.7'
21"HEMLOCK	S40°W	26.7'
CTR BIT RD	DUE N	154'

1

FD 3/4" PIPE & DROVE 5/8"X 34" REROD W/LS CAP INSIDE PIPE & ADDED CEDAR POST W/LOC TAG.

16"MAPLE	N75°E	34.5'
17"HEMLOCK	S80°E	57.0'
4"CEDAR	S45°E	24.3'
5"CEDAR	S75°W	10.6'

2

DROVE 5/8"X 36" REROD W/LS CAP AND SET CEDAR POST W/LOC TAG.

9"MAPLE	N44°E	5.26'
6"MAPLE	S30°W	15.40'
6"MAPLE	N50°W	19.63'
4"MAPLE	N20°W	17.17'

Signed by Carl F. Roser 5/10/90 Date _____

Surveyor's Michigan License No. 12028

STATE OF MICHIGAN
CARL F. ROSER
LAND SURVEYOR
No. 12028
REGISTERED LAND SURVEYOR

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983